

9890 Strain Gauge, Load Cell & mV Meter Instruction Manual



Strain Gauge

- 15, 30, 150, 300 mV Unipolar Input Ranges
- ± 15 , ± 25 , ± 150 , ± 250 mV Bipolar Input Ranges
- Selectable 5 or 10 VDC @ 350 mA Maximum Sensor Excitation
- Supports up to Twelve (12) 350 Ω Load Cells
- Capture or Programmable Tare Feature
- Auto-Zero Feature Eliminates Zero Drift
- Ratiometric Operation
- Max/Min or Peak/Valley Hold Feature
- Display One Input in Two Different Scales (e.g. Weight & Volume)
- Rounding Function 1, 2, 5, 10, 20, 50, or 100
- Dual-Line Display
- NEMA 4X and IP65 Rated Front Panel
- Display Features 0.6" & 0.46" Digits
- Six Full Digits on Each Line
- Optional Superluminous Sunlight Readable Display
- Free USB Programming Software & Cable
- 2 or 4 Relays + Isolated 4-20 mA Output Options
- USB, RS-232, & RS-485 Serial Communication Options
- External 4-Relay & Digital I/O Expansion Modules
- Input Power Options Include 85-265 VAC or 12-24 VDC
- Modbus® RTU Communication Protocol Standard

INTERFACE INC.

7418 East Helm Drive | Scottsdale, AZ 85260 | (800) 947-5598

interface
FORCE MEASUREMENT SOLUTIONS.
www.interfaceforce.com

Disclaimer

The information contained in this document is subject to change without notice. Interface Inc. makes no representations or warranties with respect to the contents hereof and specifically disclaims any implied warranties of merchantability or fitness for a particular purpose.



CAUTION: *Read complete instructions prior to installation and operation of the meter.*



WARNING: *Risk of electric shock or personal injury.*



Warning!

This product not recommended for life support applications or applications where malfunctioning could result in personal injury or property loss. Anyone using this product for such applications does so at his/her own risk. Interface Inc. Corporation shall not be held liable for damages resulting from such improper use.

Limited Warranty

Interface Inc. warrants this product against defects in material or workmanship for the specified period under "Specifications" from the date of shipment from the factory. Precision Digital's liability under this limited warranty shall not exceed the purchase value, repair, or replacement of the defective unit.

Registered Trademarks

All trademarks mentioned in this document are the property of their respective owners.

© 2019 Interface Inc. All rights reserved.

www.interfaceforce.com

Table of Contents

Table of Contents	3	Relay and Alarm Operation Diagrams	32
Table of Figures	4	<i>High Alarm Operation (Set > Reset)</i>	32
Introduction	4	<i>Low Alarm Operation (Set < Reset)</i>	32
Ordering Information	5	<i>High Alarm with Fail-Safe Operation (Set > Reset)</i> 33	
Specifications	6	<i>Low Alarm with Fail-Safe Operation (Set < Reset)</i> 33	
General.....	6	<i>Pump Alternation Control Operation</i>	33
Strain Gauge Input.....	7	<i>Relay Sampling Operation</i>	34
Relays.....	7	<i>Time Delay Operation</i>	34
Isolated 4-20 mA Transmitter Output.....	8	Relay Operation Details	35
Modbus® RTU Serial Communications.....	8	Overview.....	35
MeterView Pro.....	8	<i>Relays Auto Initialization</i>	35
Compliance Information	Error! Bookmark not defined.	<i>Fail-Safe Operation</i>	35
Safety.....	Error! Bookmark not defined.	<i>Front Panel LEDs</i>	35
Electromagnetic Compatibility....	Error! Bookmark not defined.	<i>Latching and Non-Latching Relay Operation</i>	36
Safety Information	9	<i>Non-Latching Relay (Auto)</i>	36
Installation	9	<i>Non-Latching Relay (Alarm On)</i>	36
Unpacking.....	9	<i>Latching Relay (Latch)</i>	36
Panel Mounting Instructions.....	9	<i>Latching Relay (Latch-Release)</i>	36
<i>Mounting Dimensions</i>	10	<i>Acknowledging Relays</i>	37
Sensor Excitation Voltage Selection (EX+, EX-).....	10	<i>Pump Alternation Control Applications (Relay Error)</i> ...37	
Connections.....	11	<i>Setting Up the Interlock Relay (Force On) Feature</i> 39	
<i>Connectors Labeling</i>	11	Scaling the 4-20 mA Analog Output (Auto)	39
<i>Power Connections</i>	11	Setting Up the Password (PASS)	40
<i>Signal Connections</i>	12	<i>Protecting or Locking the Meter</i>	40
<i>Switch Configuration</i>	12	<i>Making Changes to a Password Protected Meter</i> ...40	
<i>Shunt Calibration</i>	14	<i>Disabling Password Protection</i>	40
<i>Modbus RTU Serial Communications</i>	15	Reset Menu (RESET)	41
<i>Relay Connections</i>	15	Tare Menu (TARE)	41
<i>Switching Inductive Loads</i>	15	<i>Tare Functionality (TARE)</i>	41
<i>4-20 mA Output Connections</i>	16	Control Menu (Control)	41
<i>Analog Output Power Supply</i>	16	Advanced Features Menu	42
<i>F4 Digital Input Connections</i>	16	<i>Advanced Features Menu & Display Messages</i> ...42	
<i>External Relays & Digital I/O Connections</i>	17	<i>Noise Filter (Filter)</i>	43
<i>Interlock Relay Feature</i>	17	<i>Noise Filter Bypass (bypass)</i>	43
Setup and Programming	18	<i>Rounding Feature (round)</i>	43
Front Panel Buttons and Status LED Indicators.....	18	<i>Modbus RTU Serial Communications (Serial)</i>	44
MeterView® Pro Software.....	19	<i>Select Menu (Select)</i>	44
<i>MeterView Pro Installation</i>	19	<i>Signal Input Conditioning (Function)</i>	44
Display Functions & Messages.....	20	<i>Auto-Zero (Auto Z)</i>	45
Setting Numeric Values.....	22	<i>Low Cutoff (Cutoff)</i>	45
Main Menu.....	22	<i>Analog Output Programming (AutoPr)</i>	45
Setting Up the Meter (Setup).....	23	<i>Programmable Function Keys User Menu (user)</i> ...46	
<i>Setting the Input Signal (Input)</i>	24	<i>Internal Source Calibration (CAL)</i>	47
<i>Setting the Input Units (units)</i>	25	<i>Error Message (Error)</i>	48
<i>Setting the Input Units or Custom Tags (units)</i> ...26		Meter Operation	49
<i>Programming the Meter (Prd)</i>	27	Front Panel Buttons Operation.....	49
<i>Calibrating the Meter with Strain Gauge/Load Cell (CAL)</i>	27	Function Keys Operation.....	49
<i>Setting the Display Parameter & Intensity (display)</i>	29	Maximum/Minimum Readings.....	50
Setting the Relay Operation (relay).....	30	Troubleshooting	51
<i>Setting the Relay Action</i>	31	Diagnostics Menu (diag).....	51
<i>Programming Set and Reset Points</i>	32	<i>Determining Software Version</i>	51
<i>Setting Fail-Safe Operation</i>	32	Reset Meter to Factory Defaults.....	51
<i>Programming Time Delay</i>	32	<i>Factory Defaults & User Settings</i>	52
		Troubleshooting Tips (Including FAULT & ERROR Messages).....	53

Table of Figures

Figure 1. 1/8 DIN Panel Cutout Dimensions.....	9	Figure 12. mV Transducer Input Connections	14
Figure 2. Panel Mounting Details.....	9	Figure 13. Shunt Resistor	14
Figure 3. Meter Dimensions - Side View	10	Figure 14. Relay Connections.....	15
Figure 4. Meter Dimensions - Top View	10	Figure 15. AC and DC Loads Protection.....	15
Figure 5. Sensor Excitation Voltage Selection	10	Figure 16. Low Voltage DC Loads Protection	15
Figure 6. Connector Labeling for Fully Loaded 9890	11	Figure 17. 4-20 mA Output Connections.....	16
Figure 7. Power Connections.....	11	Figure 18. F4 Digital Input Connections	16
Figure 8. Strain Gauge Configuration Switch.....	12	Figure 19. Expansion Modules & DIN Rail Mounting Kit	17
Figure 9. Strain Gauge Powered by Internal Supply	13	Figure 20. External Relays Module Connections	17
Figure 10. Strain Gauge Powered by External Supply	13	Figure 21. Digital I/O Module Connections	17
Figure 11. Multiple Strain Gauges Connected Through Junction Box.....	14	Figure 22. Interlock Connections	17
		Figure 23. Acknowledge Relays with Digital Input....	37

Introduction

The 9890 is a multipurpose, easy-to-use digital strain gauge & load cell meter ideal for weighing and force measurement applications. Its superluminous LED digits make it easily readable in smoke, dust, fog, and, with the optional SunBright® display, even direct sunlight.

It accepts mV input signals up to 300 mV. With a max current of 350 mA at 10 V, it can support up to twelve (12) 350 Ω load cells (minimum load resistance of 28 Ω), making it ideal for multipoint weight measurement applications. The mV input can be scaled to display the process in two different scales; for example, pounds on display line 1 and gallons on line 2. Three of the front panel buttons can be custom-programmed for a specific operation.

The basic model includes an isolated 5 or 10VDC Sensor power supply that can be used to power the input Sensor or 24 VDC for other devices. An additional isolated 24 VDC power supply is included with the 4-20 mA output option. A digital input (F4) and micro USB port are standard on the meter.

A fully loaded 9890 meter has the following: four SPDT relays, 4-20 mA output, one 10 VDC sensor excitation, and one 24 VDC power supply. The 9890 capabilities may be enhanced by adding the following external expansion modules: four SPST relays –creating an eight-relay process meter, two digital I/O modules with four inputs and four outputs each, and RS-232 or RS-485 communication adapters.

The eight relays can be used for alarm indication or process control such as pump alternation control. The 4-20 mA isolated output, Modbus RTU serial communications, and digital I/O options make the 9890 an excellent addition to any system.

Ordering Information

Standard Models

85-265 VAC Model	12-24 VDC Model	Options Installed
9890-000-1	9890-000-3	No options
9890-020-1	9890-020-3	2 relays (PD1102*)
9890-001-1	9890-001-3	4-20 mA output (PD1103*)
9890-040-1	9890-040-3	4 relays (PD1104*)
9890-021-1	9890-021-3	2 relays & 4-20 mA output (PD1105*)
9890-041-1	9890-041-3	4 relays & 4-20 mA output (PD1107*)

*Model number for replacement option card.

SunBright Display Models

85-265 VAC Model	12-24 VDC Model	Options Installed
9890-100-1	9890-100-3	No options
9890-120-1	9890-120-3	2 relays (PD1102*)
9890-101-1	9890-101-3	4-20 mA output (PD1103*)
9890-140-1	9890-140-3	4 relays (PD1104*)
9890-121-1	9890-121-3	2 relays & 4-20 mA output (PD1105*)
9890-141-1	9890-141-3	4 relays & 4-20 mA output (PD1107*)

*Model number for replacement option card.

Accessories

Model	Description
989X-DIMXM	DIN rail mounting kit for two expansion modules
989X-4RXM	4 SPST (Form A) relays
989X-4DIOXM	4 digital inputs & 4 digital outputs (2 may be connected)
989X-232	RS-232 serial adapter
989X-432	RS-485 serial adapter
CNVT-232-485I	RS-232 to RS-422/485 isolated converter
CNVT-USB-232I	USB to RS-232 non-isolated converter
CNVT-USB-485I	USB to RS-422/485 isolated converter
CNVT-USB-485N	USB to RS-422/485 non-isolated converter

Specifications

Except where noted all specifications apply to operation at +25°C.

General

Display	Line 1: 0.60" (15 mm) high, red LEDs Line 2: 0.46" (12 mm) high, red LEDs 6 digits each (-99999 to 999999), with lead zero blanking
Display Intensity	Eight user selectable intensity levels
Display Update Rate	5/second (200 ms)
Overrange	Display flashes 999999
Underrange	Display flashes -99999
Display Assignment	The displays may be assigned to PV1, PV2, PCT, max & min, set points, PV & units, units (lower display only), net & gross weight, Modbus input, and display millivolts.
Units	lb, kg, ounce, gram, ton, metric ton (tonne), custom units.
Programming Methods	Four front panel buttons, digital inputs, PC and MeterView Pro software, or Modbus registers.
Noise Filter	Programmable from 2 to 199 (0 will disable filter)
Filter Bypass	Programmable from 0.1 to 99.9% of calibrated span
Rounding	Select 1, 2, 5, 10, 20, 50, or 100 (e.g. rounding = 10, value = 123.45, display = 123.50).
Recalibration	All ranges are calibrated at the factory. Recalibration is recommended at least every 12 months.
Max/Min Display	Max/min readings reached by the process are stored until reset by the user or until power to the meter is cycled.
Password	Three programmable passwords restrict modification of programmed settings. Pass 1: Allows use of function keys and digital inputs Pass 2: Allows use of function keys, digital inputs and editing set/reset points Pass 3: Restricts all programming, function keys, and digital inputs.
Non-Volatile Memory	All programmed settings are stored in non-volatile memory for a minimum of ten years if power is lost.

Power Options	85-265 VAC 50/60 Hz, 90-265 VDC, 20 W max or 12-24 VDC $\pm 10\%$, 15 W max. Powered over USB for configuration only.
Fuse	Required external fuse: UL Recognized, 5 A max, slow blow; up to 6 meters may share one 5 A fuse
Isolated Sensor Power Supply	Terminals EX+ & EX-: 10 VDC or 5 VDC $\pm 10\%$, rated @ 350 mA max. <i>Note: Do not use 24 VDC to power strain gauge bridge.</i>
Normal Mode Rejection	Greater than 60 dB at 50/60 Hz
Isolation	4 kV input-to-power line 500 V input-to-output (powered by external supply)
Overvoltage Category	Installation Overvoltage Category II: Local level with smaller transient overvoltages than Installation Overvoltage Category III.
Environmental	Operating temperature range: -40 to 65°C Storage temperature range: -40 to 85°C Relative humidity: 0 to 90% non-condensing
Connections	Removable screw terminal blocks accept 12 to 22 AWG wire, RJ45 for external relays, digital I/O, and serial communication adapters.
Enclosure	1/8 DIN, high impact plastic, UL 94V-0, color: black
Mounting	1/8 DIN panel cutout required: 3.622" x 1.772" (92 mm x 45 mm) Two panel mounting bracket assemblies are provided.
Tightening Torque	Screw terminal connectors: 5 lb-in (0.56 Nm)
Overall Dimensions	4.68" x 2.45" x 5.64" (119 mm x 62 mm x 143 mm) (W x H x D)
Weight	9.5 oz (269 g)
Warranty	3 years parts & labor

Strain Gauge Input

Inputs	Field selectable: 0-15, 0-30, 0-150, 0-300 mV, ± 15 , ± 25 , ± 150 , ± 250 mV, or Modbus PV (Slave)	
Accuracy	$\pm 0.03\%$ of calibrated span ± 1 count	
Minimum Load Resistance	14 Ω @ 5 V	
	28 Ω @ 10 V	
Maximum Excitation Current	350 mA @ 5 V or 10 V	
Temperature Drift	0.002% of calibrated span/ $^{\circ}\text{C}$ max from 0 to 65°C ambient, 0.005% of calibrated span/ $^{\circ}\text{C}$ max from -30 to 0°C ambient	
Functions	Linear with multi-point linearization	
Multi-Point Linearization	2 to 32 points for PV or PV1 2 to 8 points for PV2 (Dual-scale feature)	
Low-Flow Cutoff	0-999999 (0 disables cutoff function)	
Decimal Point	Up to five decimal places or none: dddddd, dddddd, dddd, ddd, dd, or dddddd	
Calibration Range	Input Range	Minimum Span
	15 mV	Input 1 & Input 2 0.2 mV
	25 mV, 30 mV	0.4 mV
	150 mV	2.0 mV
	250 mV, 300 mV	4.0 mV
	An Error message will appear if the input 1 and input 2 signals are too close together.	
Input Impedance	Strain Gauge Bridge: Greater than 10 M Ω mV Source: 200 k Ω	

Relays

Rating	2 or 4 SPDT (Form C) internal and/or 4 SPST (Form A) external; rated 3 A @ 30 VDC and 125/250 VAC resistive load; 1/14 HP (≈ 50 W) @ 125/250 VAC for inductive loads
Noise Suppression	Noise suppression is recommended for each relay contact switching inductive loads; see page 15 for details.
Deadband	0-100% of span, user programmable
High Or Low Alarm	User may program any alarm for high or low trip point. Unused alarm LEDs and relays may be disabled (turn off).
Relay Operation	Automatic (non-latching) Latching (requires manual acknowledge) Sampling (based on time) Pump alternation control (2 to 8 relays) Off (disable unused relays and enable Interlock feature) Manual on/off control mode
Relay Reset	User selectable via front panel buttons or digital inputs <ol style="list-style-type: none"> Automatic reset only (non-latching), when the input passes the reset point. Automatic + manual reset at any time (non-latching) Manual reset only, at any time (latching) Manual reset only after alarm condition has cleared (L) <p><i>Note: Front panel button or digital input may be assigned to acknowledge relays programmed for manual reset.</i></p>
Time Delay	0 to 999.9 seconds, on & off relay time delays Programmable and independent for each relay
Fail-Safe Operation	Programmable and independent for each relay. <i>Note: Relay coil is energized in non-alarm condition. In case of power failure, relay will go to alarm state.</i>
Auto Initialization	When power is applied to the meter, relays will reflect the state of the input to the meter.

Isolated 4-20 mA Transmitter Output

Output Source	Process variable (PV), max, min, set points 1-8, Modbus input, or manual control mode		
Scaling Range	1.000 to 23.000 mA for any display range		
Calibration	Factory calibrated: 0.00 to 100.00 = 4-20 mA output		
Analog Output Programming	1.000 mA minimum and 23.000 mA maximum for all parameters: overrange, underrange, max, min, and break		
Accuracy	$\pm 0.1\%$ of span ± 0.004 mA		
Temperature Drift	0.4 $\mu\text{A}/^\circ\text{C}$ max from 0 to 65°C ambient, 0.8 $\mu\text{A}/^\circ\text{C}$ max from -40 to 0°C ambient <i>Note: Analog output drift is separate from input drift.</i>		
Isolated Transmitter Power Supply	Terminals I+ & R: 24 VDC $\pm 10\%$ isolated from the input at >500 V. May be used to power the 4-20 mA output or other devices (except load cell/strain gauge). Refer to Figure 6 on page 11 and Figure 17 on page 16. All models rated @ 40 mA max.		
External Loop Power Supply	35 VDC maximum		
Output Loop Resistance	Power supply	Minimum	Maximum
	24 VDC	10 Ω	700 Ω
	35 VDC (external)	100 Ω	1200 Ω

Modbus® RTU Serial Communications

Slave ID	1 – 247 (Meter address)
Baud Rate	300 – 19,200 bps
Transmit Time Delay	Programmable between 0 and 199 ms or transmitter always on for RS-422 communication
Data	8 bit (1 start bit, 1 or 2 stop bits)
Parity	Even, Odd, or None with 1 or 2 stop bits
Byte-to-Byte Timeout	0.01 – 2.54 second
Turn Around Delay	Less than 2 ms (fixed)

MeterView Pro

System Requirements	Microsoft® Windows® XP/Vista/7/8/10
Communications	USB 2.0 (Standard USB A to Micro USB B)
Configuration	Configure meters one at a time

Safety Information

	
CAUTION: <i>Read complete instructions prior to installation and operation of the meter.</i>	WARNING: <i>Risk of electric shock or personal injury.</i>
	Hazardous voltages exist within enclosure. Installation and service should be performed only by trained service personnel.

Installation

There is no need to remove the meter from its case to complete the installation, wiring, and setup of the meter for most applications.

Instructions are provided for changing the sensor power supply to output 5 or 10 VDC instead of 24 VDC on page 10.



Unpacking

Remove the meter from box. Inspect the packaging and contents for damage. Report damages, if any, to the carrier.

If any part is missing or the meter malfunctions, please contact your supplier or the factory for assistance.

Panel Mounting Instructions

- Prepare a standard 1/8 DIN panel cutout – 3.622" x 1.772" (92 mm x 45 mm). Refer to Figure below, for more details.
- Clearance: allow at least 6.0" (152 mm) behind the panel for wiring.
- Panel thickness: 0.04" - 0.25" (1.0 mm - 6.4 mm).
Recommended minimum panel thickness to maintain Type 4X rating: 0.06" (1.5 mm) steel panel, 0.16" (4.1 mm) plastic panel.
- Remove the two mounting brackets provided with the meter (back-off the two screws so that there is 1/4" (6.4 mm) or less through the bracket. Slide the bracket toward the front of the case and remove).
- Insert meter into the panel cutout.
- Install mounting brackets and tighten the screws against the panel. To achieve a proper seal, tighten the mounting bracket screws evenly until meter is snug to the panel along its short side. **DO NOT OVER TIGHTEN**, as the rear of the panel may be damaged.

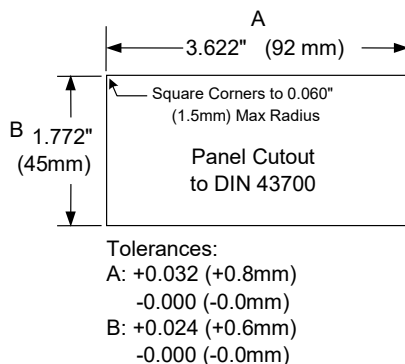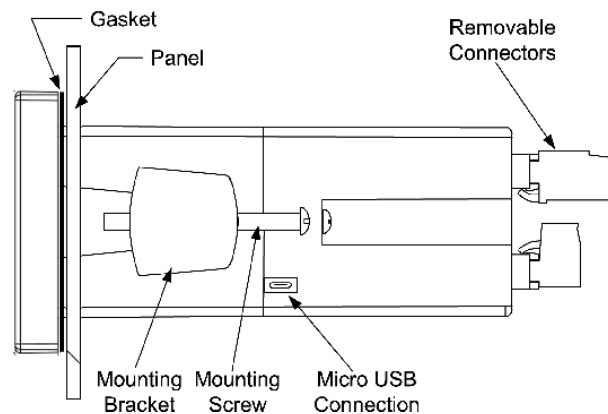

Mounting Dimensions

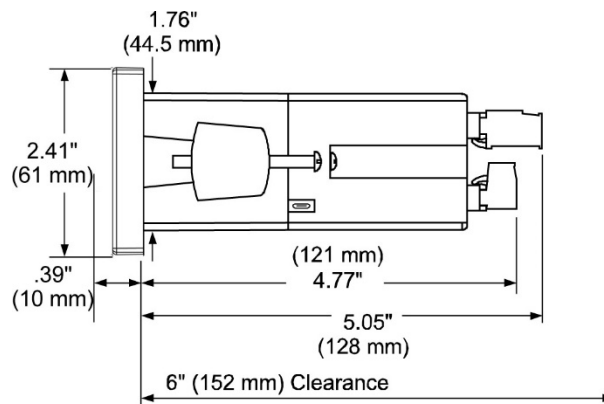


Figure 3. Meter Dimensions - Side View

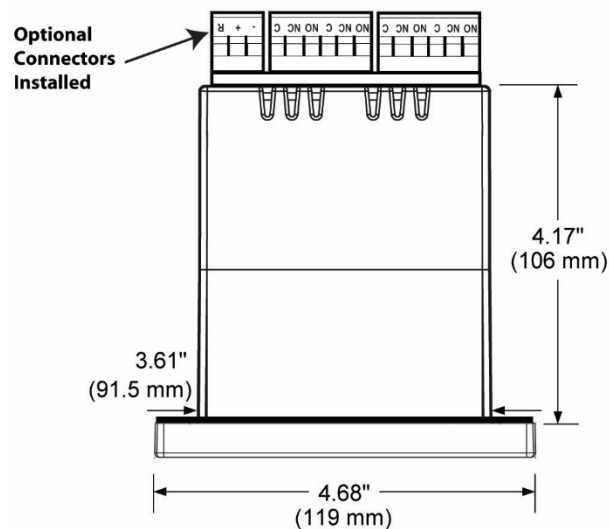


Figure 4. Meter Dimensions - Top View

Sensor Excitation Voltage Selection (EX+, EX-)

All meters, including models equipped with the 12-24 VDC power option, are shipped from the factory configured to provide 10 VDC excitation for the sensor.

If the sensor requires 5 VDC excitation, the internal jumper J3 must be configured accordingly.

To access the voltage selection jumper:

1. Remove all the wiring connectors.
2. Unscrew the back cover.
3. Slide out the back cover by about 1 ½ inches.
4. Configure the J3 jumper, located behind the input signal connector, for the desired excitation voltage as shown.

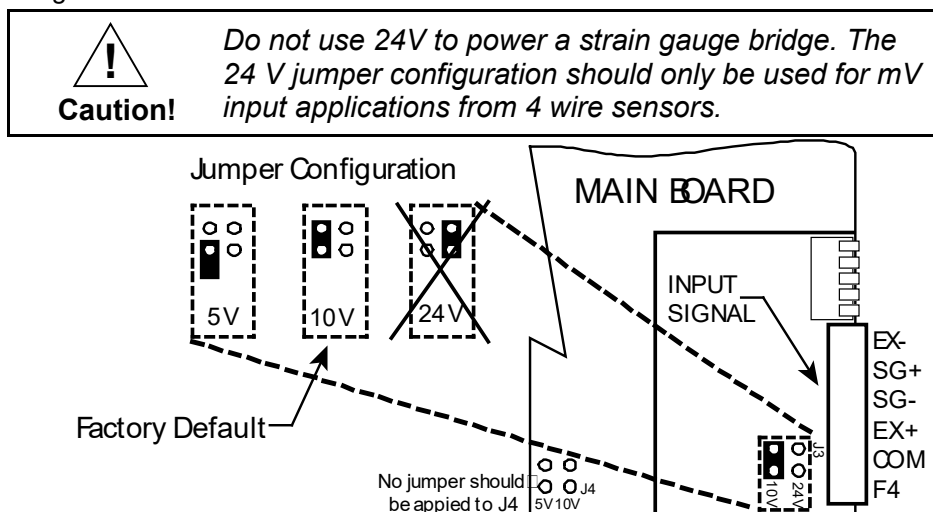


Figure 5. Sensor Excitation Voltage Selection

Connections

All connections are made to removable screw terminal connectors located at the rear of the meter.



Caution!

Use copper wire with 60°C or 60/75°C insulation for all line voltage connections. Observe all safety regulations. Electrical wiring should be performed in accordance with all applicable national, state, and local codes to prevent damage to the meter and ensure personnel safety.

Connectors Labeling

The connectors' label, affixed to the meter, shows the location of all connectors available with requested configuration.



Warning!

Do not connect any equipment other than Interface Inc. expansion modules, cables, or meters to the RJ45 M-LINK connector. Otherwise damage will occur to the equipment and the meter.


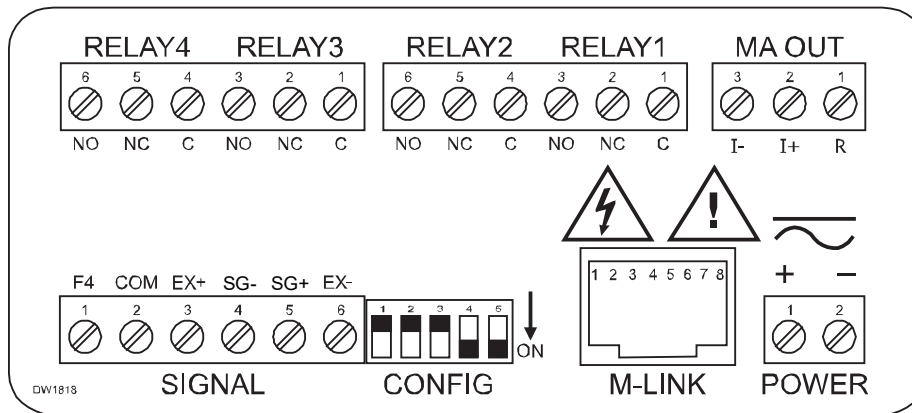


Figure 6. Connector Labeling for Fully Loaded 9890

Power Connections

Power connections are made to a two-terminal connector labeled POWER on Figure 6. The meter will operate regardless of DC polarity connection. The + and - symbols are only a suggested wiring convention.

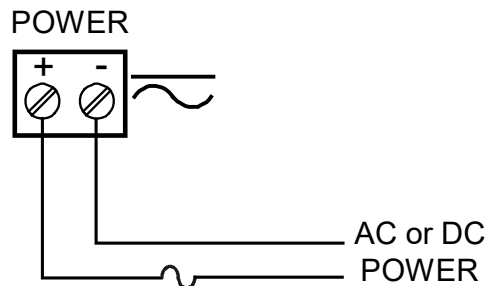

Required External Fuse:
5 A max, 250 V Slow Blow

Figure 7. Power Connections

Signal Connections

Signal connections are made to a six-terminal connector labeled SIGNAL on Figure 6. The EX+ and EX- terminals are used to sense the sensor excitation voltage for ratiometric operation, when the sensor is powered externally (switch 1 is off).

Switch Configuration

Setup and programming is performed both through the front panel buttons and switch settings shown below. The switch configuration must correspond to the setup and programming starting on page 29 (same range, type, etc.).

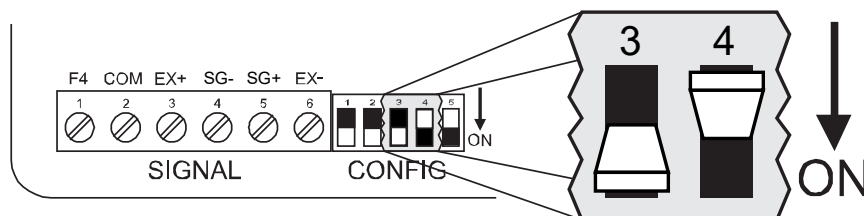


Figure 8. Strain Gauge Configuration Switch

Excitation (Switch 1)

The excitation switch designates whether the meter will use its internal power supply or an external power supply.

Switch 1	ON	Excitation	<u>Internal</u> Excitation	When switch is turned ON, the 9890's power supply is used.
	OFF	Excitation	<u>External</u> Excitation	When switch is turned OFF, an external power supply is used.

Range (Switch 2)

The range switch adjusts the gain of the internal circuitry. Narrower ranges require more amplification.

Switch 2	ON	Range	<u>Higher</u> internal gain	Turn this switch ON for the following input ranges: 15, 30, ± 15 , or ± 25 mV.
	OFF	Range	<u>Lower</u> internal gain	Turn this switch OFF for the following input ranges: 150, 300, ± 150 , or ± 250 mV.

Polarity (Switch 3)

The polarity switch selects whether the range is unipolar and starts at zero (i.e. 0 to 30 mV) or bipolar and starts at a negative value, or below zero (i.e. -15 to +15 mV).

Switch 3	ON	Polarity	Range <u>starts</u> at zero (unipolar)	Turn this switch ON for the following input ranges: 15, 30, 150, or 300.
	OFF	Polarity	Range <u>starts</u> below zero (bipolar)	Turn this switch OFF for the following input ranges: ± 15 , ± 25 , ± 150 , or ± 250 mV.

Source (Switch 4)

The source switch tells the 9890 whether the input is a strain gauge bridge (i.e. Figure 11), or it is a signal from a 2 or 4 wire transducer, or mV source (i.e. Figure 12)

Switch 4	ON	Source	Source is mV input transducer	Turn this switch ON if the connected source is a transducer*
	OFF	Source	Source is strain gauge bridge	Turn this switch OFF if the source is a strain gauge bridge

*Ratio should be set to NO in Setup Input Menu

Shunt Resistor (Switch 5)

The 9890 provides a means of simulating strain in a strain gauge bridge circuit via a 60.4K Ω shunt resistor included in the meter. This will simulate an approximate 70% full-scale load in the case of a 350 Ω strain bridge.

Switch 5	ON	Shunt	Shunt resistor is <u>connected</u> to the input bridge.	Turn switch ON when you want to simulate a strain load
	OFF	Shunt	Shunt resistor is <u>disconnected</u> from the input bridge.	Turn this switch OFF to remove the shunt resistor

Strain Gauge Connections

The following figures show examples of strain gauge connections.

There is a 5-position DIP switch (CONFIG) to set up the input ranges and ratiometric operation.

NOTE: Refer to Switch Configuration starting on page 12 for proper configuration switch positioning.

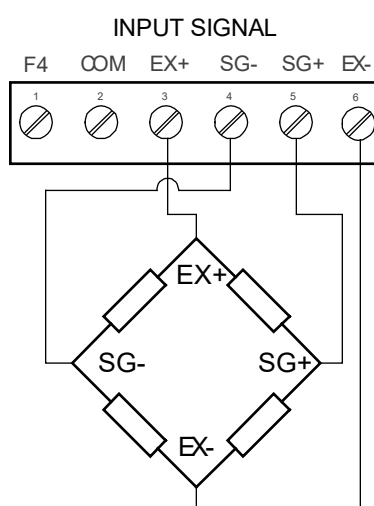


Figure 9. Strain Gauge Powered by Internal Supply

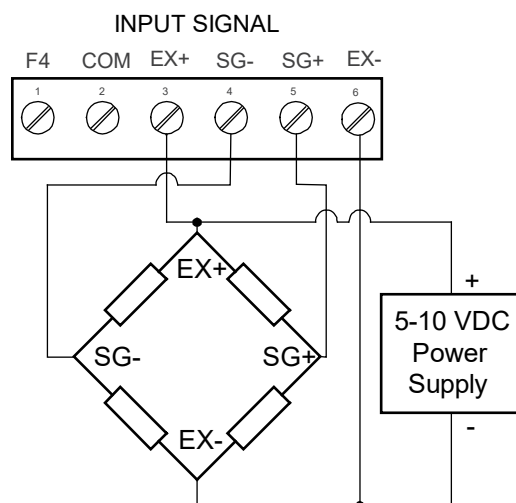


Figure 10. Strain Gauge Powered by External Supply

NOTE: Refer to Switch Configuration starting on page 12 for proper switch positioning for the following wiring configurations.

When connecting multiple strain gauges to the meter, each must be wired in parallel. This is typically done with the use of a junction box.

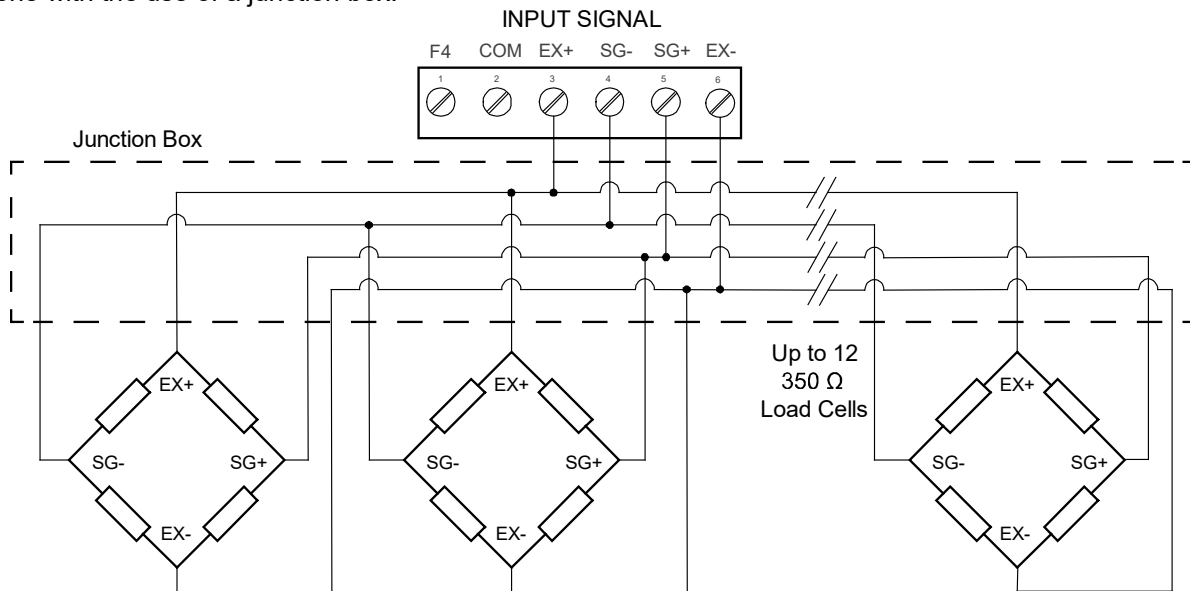


Figure 11. Multiple Strain Gauges Connected Through Junction Box

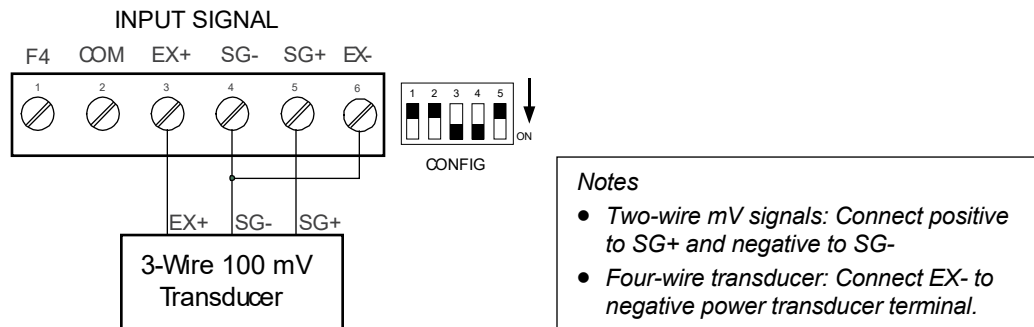


Figure 12. mV Transducer Input Connections

Shunt Calibration

The 9890 is equipped with a means of simulating strain in a strain gauge bridge circuit, via an included shunt resistor in the meter. This technique is performed by enabling the “shunt resistor” switch (switch 5), which in turn shunts one leg of a connected strain bridge with a predetermined resistive load (60.4k). This technique can be used as a means of verifying instrumentation by simulating a physical input. With no load connected, the enabling of the shunt resistor (switch 5) will simulate approximately a 70% F.S. load in the case of a 350Ω Strain Bridge.

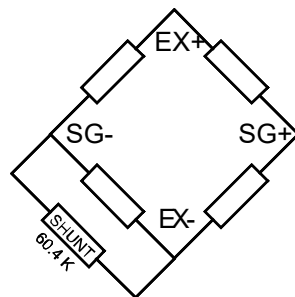


Figure 13. Shunt Resistor

Modbus RTU Serial Communications

Serial communications connection is made to an RJ45 connector labeled M-LINK on **Error! Reference source not found.** For interfacing to the 9890 use the 989X-232 for RS-232 or the 989X-485 for RS-485. The same port is used for interfacing with all expansion modules (e.g. external relays, digital I/O).

Relay Connections

Relay connections are made to two six-terminal connectors labeled RELAY1 – RELAY4 on Figure 6. Each relay's C terminal is common only to the normally open (NO) and normally closed (NC) contacts of the corresponding relay. The relays' C terminals should not be confused with the COM (common) terminal of the INPUT SIGNAL connector.

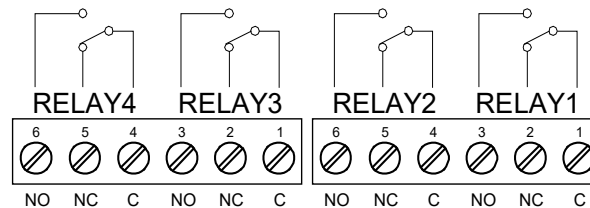


Figure 14. Relay Connections

Switching Inductive Loads

The use of suppressors (snubbers) is strongly recommended when switching inductive loads to prevent disrupting the microprocessor's operation. The suppressors also prolong the life of the relay contacts. Suppression can be obtained with resistor-capacitor (RC) networks assembled by the user or purchased as complete assemblies. Refer to the following circuits for RC network assembly and installation:

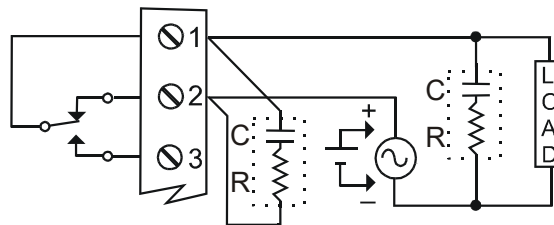


Figure 15. AC and DC Loads Protection


Choose R and C as follows:

R: 0.5 to 1 Ω for each volt across the contacts

C: 0.5 to 1 μF for each amp through closed contacts

Notes:

1. Use capacitors rated for 250 VAC.
2. RC networks may affect load release time of solenoid loads. Check to confirm proper operation.
3. Install the RC network at the meter's relay screw terminals. An RC network may also be installed across the load. Experiment for best results.

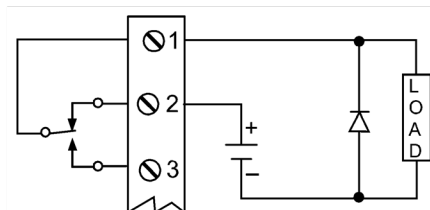

Use a diode with a reverse breakdown voltage two to three times the circuit voltage and forward current at least as large as the load current.

Figure 16. Low Voltage DC Loads Protection

RC Networks Available from Interface Inc.

RC networks are available from Interface Inc. and should be applied to each relay contact switching an inductive load. Part number: PDX6901.

Note: Relays are de-rated to 1/14th HP (50 watts) with an inductive load.

4-20 mA Output Connections

Connections for the 4-20 mA transmitter output are made to the connector terminals labeled MA OUT. The 4-20 mA output may be powered internally or from an external power supply.

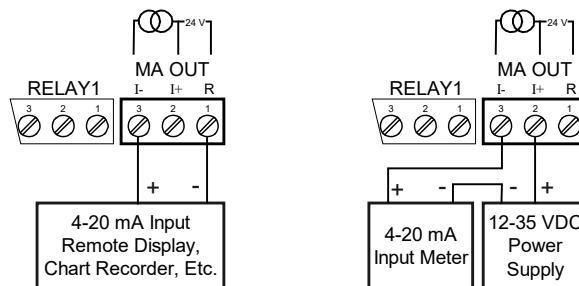


Figure 17. 4-20 mA Output Connections

Analog Output Power Supply

If the analog output is not using the 24 VDC supply to power the output loop, it can be used for other things. The I+ Terminal is the +24 V and the R terminal is the return.

F4 Digital Input Connections

A digital input, F4, is standard on the meter. This digital input is connected with a normally open contact across F4 and COM, or with an active low signal applied to the F4.

The functionality of the F4 input is set up in the Advanced Features, *User* menu.

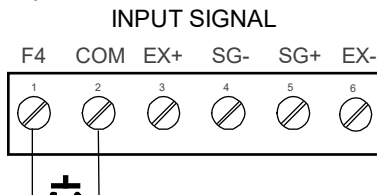


Figure 18. F4 Digital Input Connections

External Relays & Digital I/O Connections

The relay and the digital I/O expansion modules PDA1004 & PDA1044 are connected to the meter using a CAT5 cable provided with each expansion module. The two RJ45 connectors on the expansion modules are identical and interchangeable; they are used to connect additional modules to the system.

Note: The jumper located between the RJ45 connectors of the PDA1044 must be removed on the second digital I/O module in order for the system to recognize it as module #2.



Warning!

Do not connect or disconnect the expansion modules with the power on!
More detailed instructions are provided with each optional expansion module.

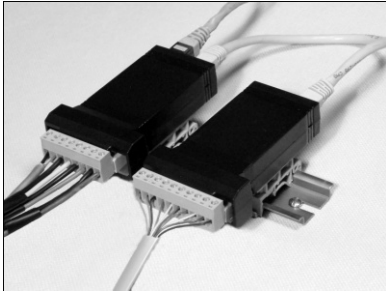


Figure 19. Expansion Modules & DIN Rail Mounting Kit

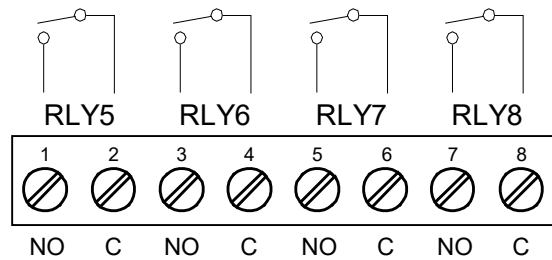


Figure 20. External Relays Module Connections

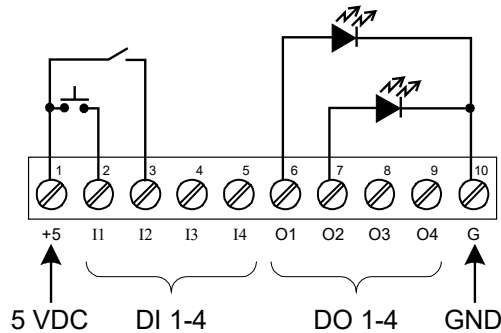


Figure 21. Digital I/O Module Connections

Interlock Relay Feature

As the name implies, the interlock relay feature reassigns one, or more, alarm/control relays for use as interlock relay(s). Interlock contact(s) are wired to digital input(s) and trigger the interlock relay. This feature is enabled by configuring the relay, and relative digital input(s) (see page 39). In one example, dry interlock contacts are connected in series to one digital input which will be used to force on (energize) the assigned interlock power relay when all interlock contacts are closed (safe). The interlock relay front panel LED flashes when locked out. The interlock relay would be wired in-series with the load (N/O contact). See below.

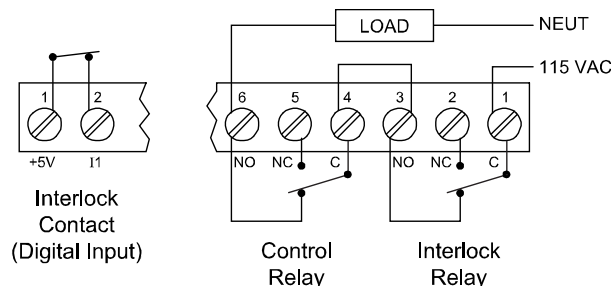


Figure 22. Interlock Connections

Setup and Programming

The meter is factory calibrated prior to shipment to read in millivolts. The calibration equipment is certified to NIST standards.

Overview

There is a 5-position DIP switch to set the meter input selection. See Figure 8 on page 12 to setup the switch.

Setup and programming is done through the front panel buttons.

After power and input signal connections have been completed and verified, apply power to the meter.

Front Panel Buttons and Status LED Indicators



Button Symbol	Description	LED	Status
	Menu	1-8	Alarm 1-8 indicator
	Right arrow/F1 Zero Meter	1-8 M	Flashing: Relay in manual control mode
	Up arrow/F2 Reset Tare	T G	Flashing: Tare (Net) Gross
	Enter/F3 Tare	1-4	Flashing: Relay interlock switch open
Note: Alarms 5-8 are enabled when relay expansion module is installed.		Note: LEDs for relays in manual mode flash with the "M" LED every 10 seconds.	

- Press the Menu button to enter or exit the Programming Mode at any time.
- Press the Right arrow button to move to the next digit during digit or decimal point programming.
- Press or hold the Up arrow button to scroll through the menus, decimal point, or to increment the value of a digit.
- Press the Enter button to access a menu or to accept a setting.
- Press and hold the Menu button for three seconds to access the advanced features of the meter.

MeterView® Pro Software


The meter can also be programmed using the PC-based MeterView Pro software included with the meter. This software can be installed on any Microsoft® Windows® (XP/Vista/7/8/10) computer by connecting the meter's onboard USB. The meter is powered by the USB connection, so there is no need to wire anything prior to programming the meter, though USB is intended only for meter configuration.

MeterView Pro Installation






1. Connect one end of the provided USB cable to the meter and the other end to the computer. The computer will automatically install the driver software it needs to talk to the meter.

Only one meter may be connected at a time.

Attaching multiple meters will cause a conflict with the meter software.

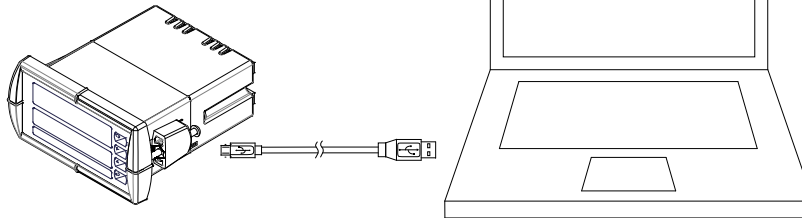

2. Once the driver is installed, an AutoPlay dialog should appear for the drive "MAINSTAL." Click "Open folder to view files." If the computer does not display an AutoPlay dialog for the drive "MAINSTAL," you should open My Computer and double-click on the drive labeled "MAINSTAL."
3. Double-click on the file named "MAStart." The program will open a few windows and install two programs on your computer. Simply follow the onscreen instructions until you see one of the dialogs below. If you receive a "User Account Control" warning, click "Yes."
4. If there is an update available, click the "Update" button to install the new version. Otherwise, click "Configure" to begin programming your meter.

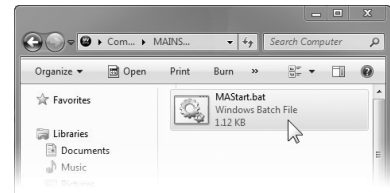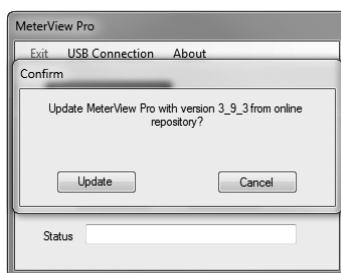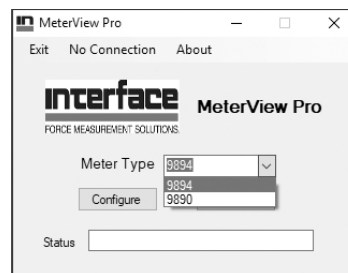

Note: If you decide to update your MeterView Pro software, once the installation has completed, you will be asked if you want to update the setup files located on the meter itself. This way, you will always have the most current version on the meter for future installs.



Warning!

Do not unplug the meter while the new installation files are being written to it. The meter will display *uwrite* during the process and you will receive an onscreen notification once the process is complete.

Data logging for one meter at a time is available with MeterView Pro software. More advanced data acquisition may be accomplished by using any Modbus RTU compliant software. Additional information regarding configuration and monitoring of the meter using MeterView Pro software is available online. Go to www.interfaceforce.com

Display Functions & Messages

The meter displays various functions and messages during setup, programming, and operation. The following table shows the main menu functions and messages in the order they appear in the menu.

Display	Parameter	Action/Setting Description	Display	Parameter	Action/Setting Description
setup	<i>Setup</i>	Enter <i>Setup</i> menu	SCAL 1	<i>Scale 1</i>	Enter the <i>Scale</i> menu for PV1
Input	<i>Input</i>	Enter <i>Input</i> selection menu	SCAL 2	<i>Scale 2</i>	Enter the <i>Scale</i> menu for PV2
Polar	<i>Polar</i>	Enter unipolar or bipolar selection menu	Cal	<i>Calibrate</i>	Enter the <i>Calibration</i> menu
uni	<i>Unipolar</i>	Press Enter to select operation with positive signals only (e.g. 0-30 mV)	inp 1	<i>Input 1</i>	Calibrate input 1 signal or program input 1 value
bi	<i>Bipolar</i>	Press Enter to select operation with positive & negative signals (e.g. ± 15 mV)	Dis 1	<i>Display 1</i>	Program display 1 value
range	<i>Range</i>	Enter range selection menu	inp 2	<i>Input 2</i>	Calibrate input 2 signal or program input 2 value (up to 32 points)
15 mv	<i>15 mV</i>	Set meter for 15 mV input (uni/bi)	Dis 2	<i>Display 2</i>	Program display 2 value (up to 32 points)
25 mv	<i>25 mV</i>	Set meter for ± 25 mV input (bi)	Error	<i>Error</i>	Error, calibration not successful, check signal or programmed value
30 mv	<i>30 mV</i>	Set meter for 30 mV input (uni)	dspl ay	<i>Display</i>	Enter the <i>Display</i> menu
150mv	<i>150 mV</i>	Set meter for 150 mV input (uni/bi)	Li ne 1	<i>Line 1</i>	Press Enter to assign the upper display parameter (default: PV)
250mv	<i>250 mV</i>	Set meter for ± 250 mV input (bi)	Li ne 2	<i>Line 2</i>	Press Enter to assign the lower display parameter (default: engineering units)
300mv	<i>300 mV</i>	Set meter for 300 mV input (uni)	d-Int y	<i>Display intensity</i>	Set display intensity level from 1 to 8
ratio	<i>Ratiometric</i>	Press Enter to select ratiometric operation to compensate for excitation changes.	RELa Y	<i>Relay</i>	Enter the <i>Relay</i> menu
d- SCAL	<i>Dual-Scale</i>	Press Enter to select dual-scale display (Select Yes or No)	RLY 1	<i>Relay 1</i>	Relay 1 setup
uni ts	<i>Units</i>	Select the display units/tags	Act 1	<i>Action 1</i>	Set relay 1 action
Dec pt	<i>Decimal point</i>	Set decimal point	Aut o	<i>Automatic</i>	Set relay for automatic reset
Pv 1	<i>PV1</i>	PV1 decimal point (dual-scale)	A- nma n	<i>Auto-manual</i>	Set relay for automatic & manual reset any time
Pv 2	<i>PV2</i>	PV2 decimal point (dual-scale)	Lat CH	<i>Latching</i>	Set relay for latching operation
prog	<i>Program</i>	Enter the <i>Program</i> menu			
SCALE	<i>Scale</i>	Enter the <i>Scale</i> menu			

Display	Parameter	Action/Setting Description
Lt - CLr	<i>Latching-cleared</i>	Set relay for latching operation with manual reset only after alarm condition has cleared
Al t e r n	<i>Alternate</i>	Set relay for alternation control
Sanmpl	<i>Sampling</i>	Set relay for sampling operation
OFF	<i>Off</i>	Disable relay and front panel status LED (Select Off to enable Interlock feature)
Set 1	<i>Set 1</i>	Program set point 1
RSt 1	<i>Reset 1</i>	Program reset point 1
RLY 2	<i>Relay 2</i>	Relays 2-8 setup <i>Note: Relays 5-8 are shown, only if expansion relay module is installed.</i>
Fai LSF	<i>Fail-safe</i>	Enter <i>Fail-safe</i> menu
FLS 1	<i>Fail-safe 1</i>	Set relay 1 fail-safe operation
on	<i>On</i>	Enable fail-safe operation
FLS 2	<i>Fail-safe 2</i>	Set relays 2-8 fail-safe operation
DeLAY	<i>Delay</i>	Enter relay <i>Time Delay</i> menu
DLY 1	<i>Delay 1</i>	Enter relay 1 time delay setup
On 1	<i>On 1</i>	Set relay 1 On time delay
OFF 1	<i>Off 1</i>	Set relay 1 Off time delay
DLY 2	<i>Delay 2</i>	Enter relays 2-8 time delay setup
Aout	<i>Analog output</i>	Enter the <i>Analog output</i> scaling menu
Dis 1	<i>Display 1</i>	Program display 1 value
Out 1	<i>Output 1</i>	Program output 1 value (e.g. 4.000 mA)

Display	Parameter	Action/Setting Description
Dis 2	<i>Display 2</i>	Program display 2 value
Out 2	<i>Output 2</i>	Program output 2 value (e.g. 20.000 mA)
r e s e t	<i>Reset</i>	Press Enter to access the <i>Reset</i> menu
Rst Hi	<i>Reset high</i>	Press Enter to reset max display
Rst Lo	<i>Reset low</i>	Press Enter to reset min display
Rst HL	<i>Reset high & low</i>	Press Enter to reset max & min displays
Rst tr	<i>Reset tare</i>	Press Enter to reset tare
t a r e	<i>Tare</i>	Enter <i>Tare</i> menu
Capt ur	<i>Capture</i>	Press Enter to set meter to capture tare using the Tare button
Prog T	<i>Programmable</i>	Press Enter to set meter to programmable tare and enter a value
Of f	<i>Off</i>	Press Enter to disable the tare function
Cont r l	<i>Control</i>	Enter <i>Control</i> menu
Aut o	<i>Automatic</i>	Press Enter to set meter for automatic operation
nmAn	<i>Manual</i>	Press Enter to manually control relays or analog output operation
pass	<i>Password</i>	Enter the <i>Password</i> menu
Pass 1	<i>Password 1</i>	Set or enter Password 1
Pass 2	<i>Password 2</i>	Set or enter Password 2
Pass 3	<i>Password 3</i>	Set or enter Password 3
unl oc	<i>Unlocked</i>	Program password to lock meter
l o c d	<i>Locked</i>	Enter password to unlock meter
999999 - 99999	<i>Flashing</i>	Over/under range condition


Setting Numeric Values

The numeric values are set using the Right and Up arrow buttons. Press Right arrow to select next digit and Up arrow to increment digit value.

The digit being changed is displayed brighter than the rest.

Press and hold up arrow to auto-increment the display value.


Press the Enter button, at any time, to accept a setting or Menu button to exit without saving changes.

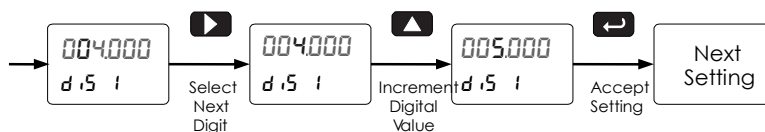

Main Menu

The main menu consists of the most commonly used functions: *Setup*, *Reset*, *Tare*, *Control*, and *Password*.

- Press Menu button to enter Programming Mode then press the Up arrow button to scroll main menu.

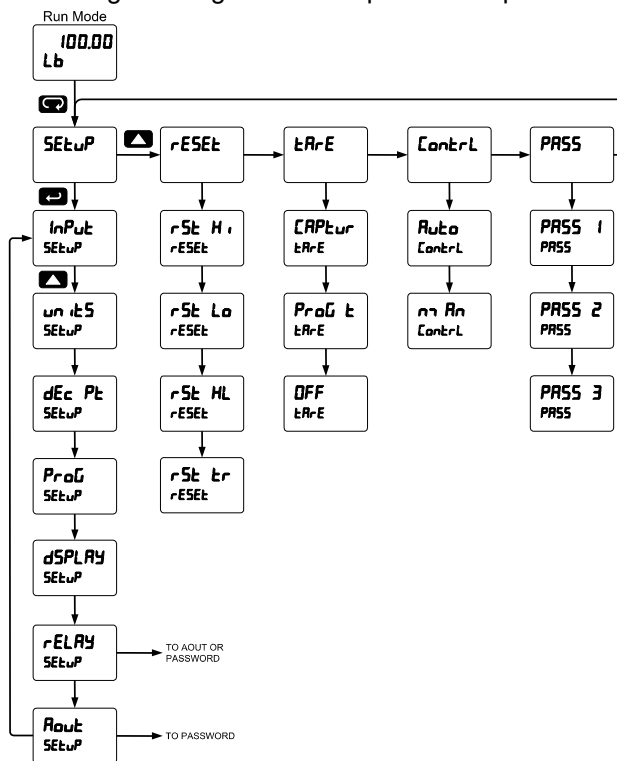


- Press Menu, at any time, to exit and return to Run Mode. Changes made to settings prior to pressing Enter are not saved.
- Changes to the settings are saved to memory only after pressing Enter.
- The display moves to the next menu every time a setting is accepted by pressing Enter.

Setting Up the Meter (SEtUP)

The *Setup* menu is used to select:


1. Unipolar (e.g. 0-30 mV) or bipolar (e.g. ± 25 mV) polarity, input range, ratiometric operation, and dual-scale feature
2. Engineering units
3. Decimal point position
4. Program scaling or live calibration
5. Display parameter and intensity
6. Relay operation
7. 4-20 mA analog output scaling

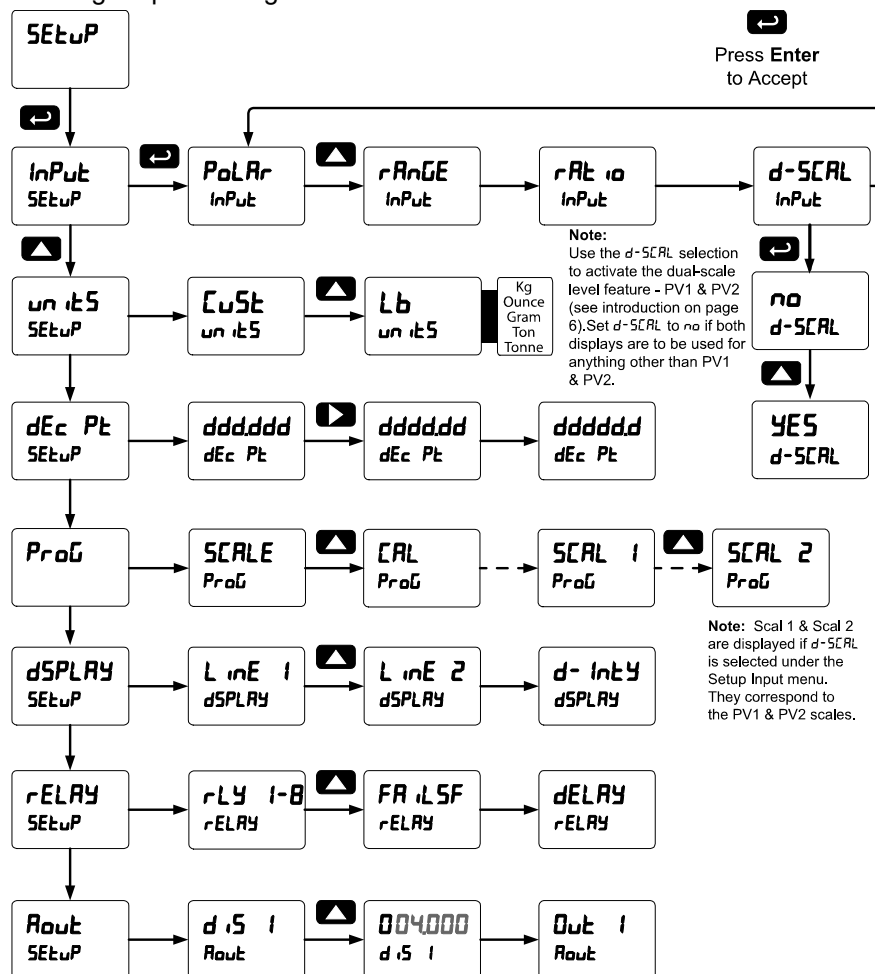

Setting the Input Signal (InPut)

Enter the *Input* menu to set up the input polarity, range, ratiometric operation, and dual-scale feature. The meter is capable of accepting any signal from -250 to 250 mV in bipolar mode or up to 300 mV in unipolar mode.

After selecting “Yes” or “No” for *ratio*, *d-SCAL* is displayed. Selecting “Yes” enables the dual-scale feature, allowing scaling of the same input in two different scales (for PV1 & PV2) or displaying the percentage of PV1.

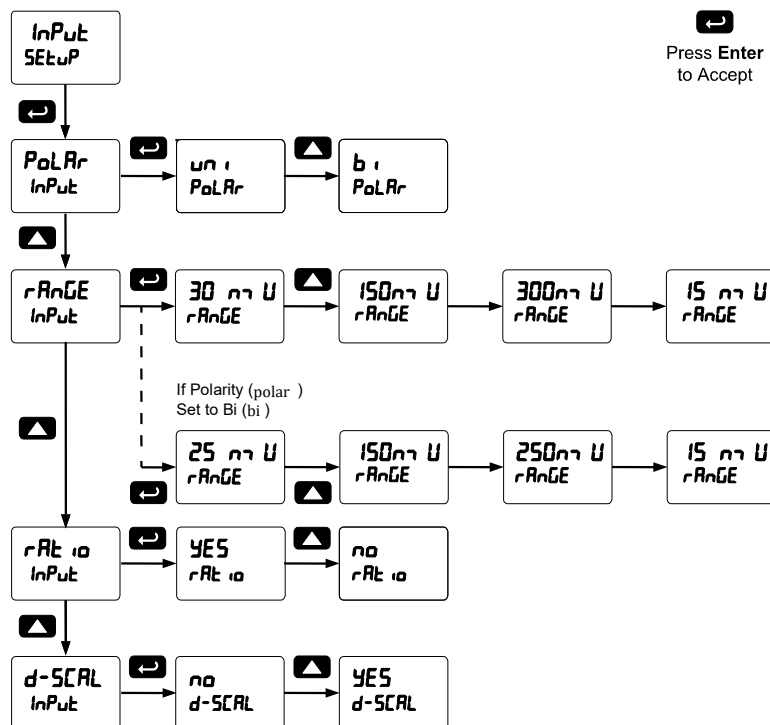

Input Polarity Selection (PoLAR)

Select unipolar operation for inputs in ranges from 0 to 300 mV and select bipolar operation for inputs in ranges from -250 mV to +250 mV. This setting determines the selectable ranges for the millivolt input.

NOTE: Refer to *Switch Configuration* starting on page 12 for proper switch positioning.

Range Selection (RANGE)

This menu is used to select the input range. The selections listed are determined by the *Polarity* setting.

Unipolar mode: 0-15, 0-30, 0-150, 0-300 mV

Bipolar mode: ± 15 , ± 25 , ± 150 , ± 250 mV

NOTE: Refer to *Switch Configuration* starting on page 12 for proper switch positioning.

Ratiometric Operation (rAt io)

Ratiometric operation corrects the measured strain gauge signal for up to $\pm 5\%$ variation of either the internal or external excitation power supply. In order to use the ratiometric operation, the ratiometric operation menu must be set to yes (YES).

Dual-Scale (d-SCAL)

The analog input can be displayed in two different scales, by enabling the dual-scale feature in the *Setup-Input* menu, see page 24.

To enable the dual-scale feature you must select d-SCAL in the Input selection menu.

Setting the Input Units (Units)

Enter the pre-defined engineering unit or custom unit. The pre-defined units have automatic conversion factors. This unit will be displayed if a unit is selected as the lower display parameter. See the flow chart on page 29 to access the display menu to show the unit on the lower display.


The custom unit may also be used to enter a display tag.

Pre-defined engineering units: lb, kg, ounce, gram, ton (short), tonne (metric ton). The meter converts the reading according to the unit selected (e.g. 100.00 lb = 45.36 kg = 45359.2 g = 1600 oz).

Unit Conversions: After scaling values in the *Scale* menu have been entered during setup, automatic unit conversions are done when switching from any standard unit to any other standard unit during future changes of the *Units* menu.

Once a standard unit has been selected in the units menu, the user must then set their scaling values for that unit (under the setup menu) in order for that unit's conversion factor to take effect. Otherwise, the meter will allow the user to freely switch between standard unit selections, without applying a conversion factor.

Note that if the dual-scale feature is selected in the *Setup* menu, both PV1 and PV2 will be converted from the original standard unit to the new standard unit. A scaled PV not scaled for the selected units must be reprogrammed. *Example:* If PV 1 is scaled for pounds, and PV 2 scaled for gallons; if the *Units* selection is changed from *Lb* to *ounce*, PV 2 will need to be re-scaled manually back to gallons.

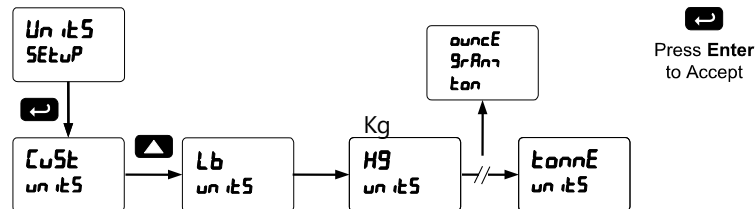

Note: PV1 and PV2 may use different standard units as starting points, however the user must select the unit and complete scaling for both PV1 and PV2 individually. For example, set PV1 equal to "Lbs" and complete the scaling for PV1 only. PV1 is now reading in Lbs. Then, change the units for PV2 to be "Kg" and complete the scaling for PV2. PV2 will read in kilograms and PV1 will reflect the conversion from Lbs to Kgs.

Setting the Input Units or Custom Tags (Unit 5)

Enter the input unit or custom tag that will be displayed if units are selected in the Unit 5 menu, or dUnit is selected as the lower display parameter. See the flow chart on page 29 to access the display menu to show the unit or tag on the lower display. The engineering units or custom legends can be set using the following 7-segment character set:

Display	Character	Display	Character	Display	Character	Display	Character
0	0	C	C	k	K	v	V
1	1	c	c	l	L	uw	w
2	2	d	d	nm	m	x	X
3	3	e	E	n	n	y	Y
4	4	f	F	O	O	z	Z
5	5	g	G	o	o	-	-
6	6	9	g	p	P	/	/
7	7	H	H	q	q	[	]
8	8	h	h	r	r	]	[
9	9	l	l	s	S	=	=
A	A	l	i	t	t	!	Degree(<)
b	b	j	J	u	u		Space

Notes: Degree symbol represented by (<) if programming with MeterView® Pro. The letters “m” and “w” use two 7-segment LEDs each; when selected the characters to the right are shifted one position. Press and hold up arrow to auto-scroll the characters in the display.


Setting the Decimal Point (dEc Pt)

The decimal point may be set with up to five decimal places or with no decimal point at all.

Pressing the Right arrow moves the decimal point one place to the right until no decimal point is displayed, and then it moves to the leftmost position.

Pressing the Up arrow moves the decimal point to the left.

If the dual-scale feature is selected, the decimal point selections for PV1 & PV2 are enabled.

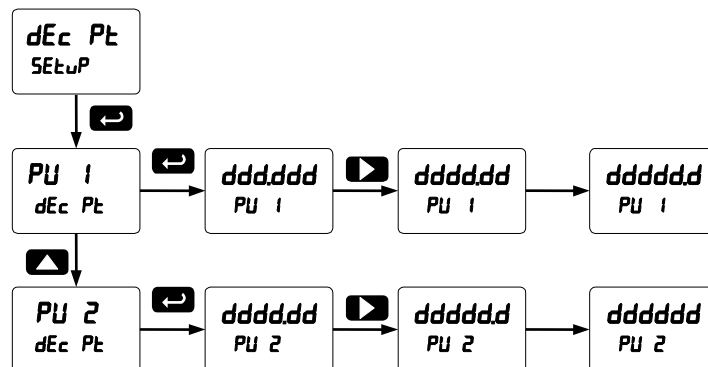

Programming the Meter (Prog)

The *Program* menu contains the *Scale* and the *Calibrate* menus.

For strain gauge and load cell applications it is **recommended to calibrate** the meter using the sensor as the input and with ratiometric operation enabled to compensate for small variation in the excitation voltage.


It is **very important** to read the following information, before proceeding to program the meter:

- The meter is factory calibrated prior to shipment to read in millivolts. The calibration equipment is certified to NIST standards.
- Use the *Scale* menu to scale the input (e.g. 0-100 mV). A calibrated signal source is not needed to scale the meter.
- The 9890 is a single input meter with dual-scale capability.


If the dual-scale feature is selected in the *Setup* menu, the *Scale 1* and *Scale 2* menus are enabled for PV1 & PV2 respectively.

The process inputs may be calibrated or scaled to any display value within the range of the meter.

Program Menu for Single Scale Process

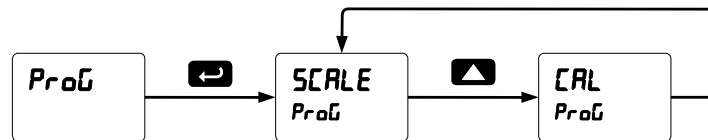

Program Menu for Dual-Scale Applications

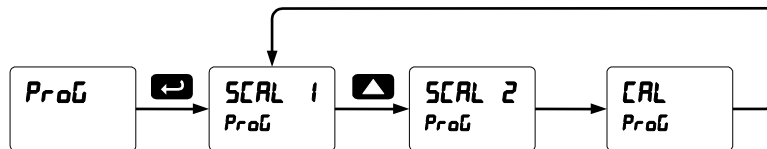


Additional parameters, not needed for most applications, are programmed in the *Advanced Features* menu; see Advanced Features Menu, page 42.

Calibrating the Meter with Strain Gauge/Load Cell (CAL)

To scale the meter without a signal source, refer to Scaling the Meter (SCALE), page 28.

The meter can be calibrated to display the process variable in engineering units by applying the appropriate input signal and following the calibration procedure.

The use of a calibrated signal source is strongly recommended to calibrate the meter.

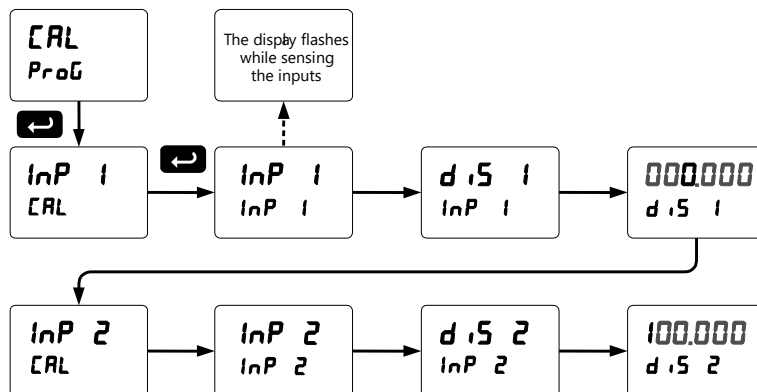


Warm up the meter for at least 15 minutes before performing calibration to ensure specified accuracy.

Multi-Point Calibration & Scaling

The meter is set up at the factory for 2-point linear calibration. The number of points for multi-point calibration/scaling is set up in the *Advanced Features* menu. Up to 32 linearization points may be selected for PV1 and up to 8 linearization points may be selected for PV2. See page 45 for details.

Scaling the Meter (SCALE)


The strain gauge input (e.g. 0-100 mV) can be scaled to display the process variable in engineering units. A signal source is not needed to scale the meter; simply program the inputs and corresponding display values.

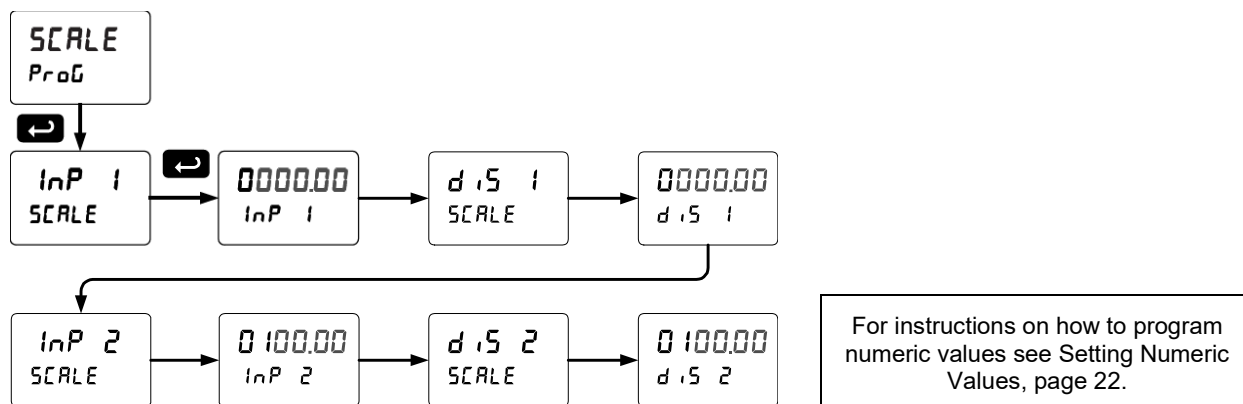

Dual-Scale Application

The analog input can be displayed in two different scales, by enabling the dual-scale feature in the *Setup Input* menu, see page 24.

To enable the dual-scale feature you must select it in the Input selection menu.

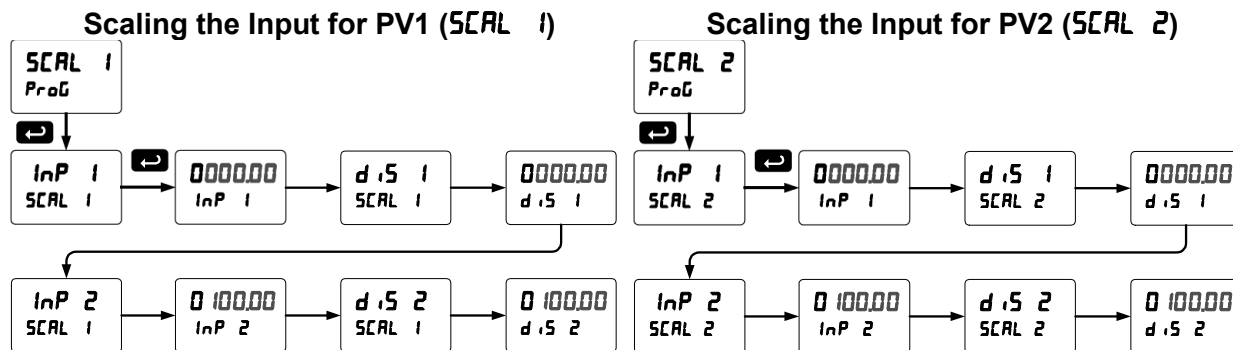

Error Message (Error)

An error message indicates that the calibration or scaling process was not successful.

After the error message is displayed, the meter reverts to input 2 during calibration or scaling and to input 1 during internal calibration, allowing the appropriate input signal to be applied or programmed.

The error message might be caused by any of the following conditions:

1. Input signal is not connected to the proper terminals or it is connected backwards.
2. Wrong signal selection in *Setup* menu.
3. Minimum input span requirements not maintained.
4. Input 1 signal inadvertently applied to calibrate input 2.

Minimum Input Span

The minimum input span is the minimum difference between input 1 and input 2 signals required to complete the calibration or scaling of the meter.

Input Range	Input 1 & Input 2 Span
15 mV	0.2 mV
25 mV, 30 mV	0.4 mV
150 mV	2.0 mV
250 mV, 300 mV	4.0 mV

Display line 1 (LINE 1) can be programmed to display:

- Display line 2 (LINE 2) can be programmed to display:

- Display Intensity:** The meter has eight display intensity levels to give the best performance under various lighting conditions. Select intensity 8 for outdoor applications. The default intensity setting is 8.



Setting the Relay Operation (rELAY)


This menu is used to set up the operation of the relays.



Caution!

During setup, the relays do not follow the input and they will remain in the state found prior to entering the Relay menu.

1. Relay action
 - a. Automatic reset only (non-latching)
 - b. Automatic + manual reset at any time (non-latching)
 - c. Latching (manual reset only)
 - d. Latching with Clear (manual reset only after alarm condition has cleared)
 - e. Pump alternation control (automatic reset only)
 - f. Sampling (the relay is activated for a user-specified time)
 - g. Off (relay state controlled by Interlock feature)
2. Set point
3. Reset point
4. Fail-safe operation
 - a. On (enabled)
 - b. Off (disabled)
5. Time delay
 - a. On delay (0-999.9 seconds)
 - b. Off delay (0-999.9 seconds)

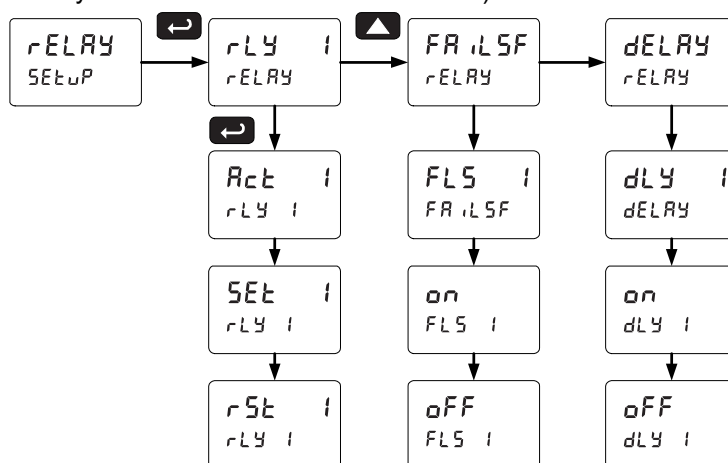


Note: The setup of relays 2-8 follows the same pattern shown here for relay 1.

Setting the Relay Action

Operation of the relays is programmed in the *Action* menu. The relays may be set up for any of the following modes of operation:

1. Automatic reset (non-latching)
2. Automatic + manual reset at any time (non-latching)
3. Latching (manual reset only, at any time)
4. Latching with Clear (manual reset only after alarm condition has cleared)
5. Pump alternation control (automatic reset only)
6. Sampling (the relay is activated for a user-specified time)
7. Off (relay state controlled by Interlock feature)

The following graphic shows relay 1 action setup; relay 2-8 are set up in a similar fashion.

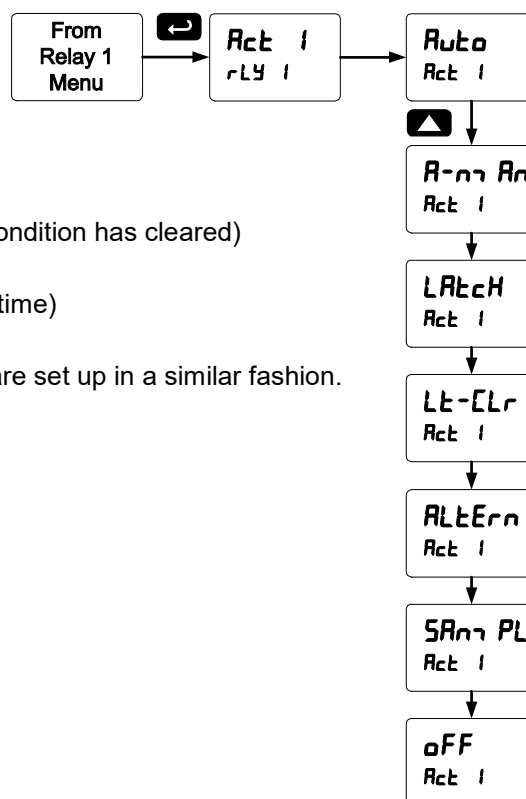


Programming Set and Reset Points

High alarm indication: program set point above reset point.

Low alarm indication: program set point below reset point.

The deadband is determined by the difference between set and reset points. Minimum deadband is one display count. If the set and reset points are programmed with the same value, the relay will reset one count below the set point.

Note: Changes are not saved until the reset point has been accepted.

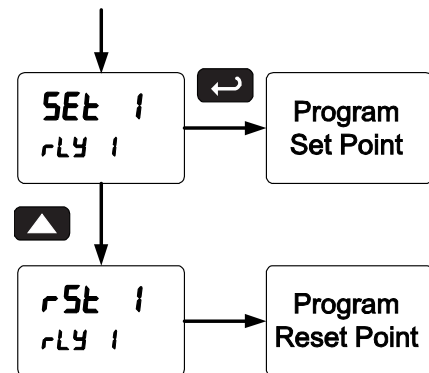

Setting Fail-Safe Operation

In fail-safe mode of operation, the relay coil is energized when the process variable is within safe limits and the relay coil is de-energized when the alarm condition exists. The fail-safe operation is set independently for each relay. Select **on** to enable or select **off** to disable fail-safe operation.

Programming Time Delay

The *On* and *Off* time delays may be programmed for each relay between 0 and 999.9 seconds. The relays will transfer only after the condition has been maintained for the corresponding time delay.


The *On* time delay is associated with the set point.

The *Off* time delay is associated with the reset point.

Relay and Alarm Operation Diagrams


The following graphs illustrate the operation of the relays, status LEDs, and ACK button.

High Alarm Operation (Set > Reset)

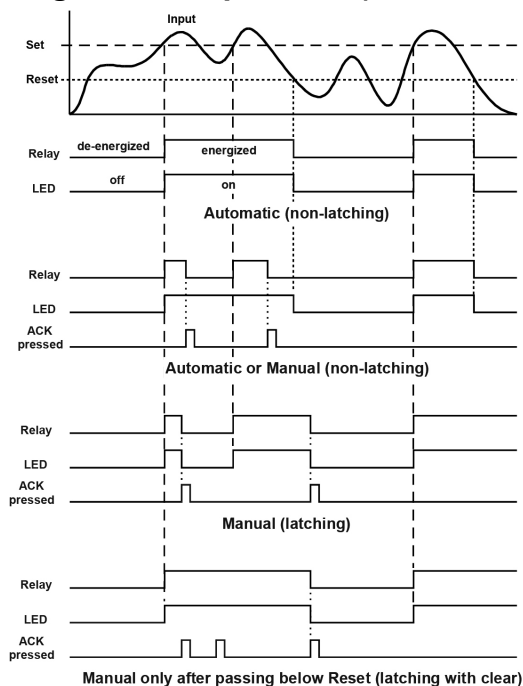


For Manual reset mode, ACK can be pressed anytime to turn "off" relay. To detect a new alarm condition, the signal must go below the set point, and then go above it.

Low Alarm Operation (Set < Reset)

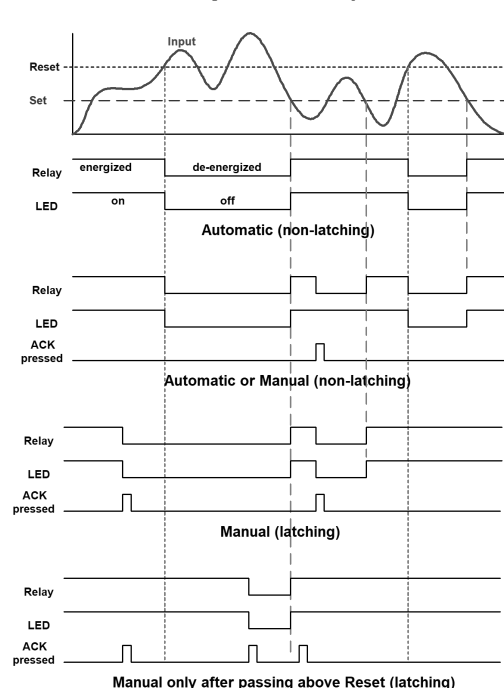


For Manual reset mode, ACK can be pressed anytime to turn "off" relay. For relay to turn back "on", signal must go above set point, and then go below it.

High Alarm with Fail-Safe Operation (Set > Reset)

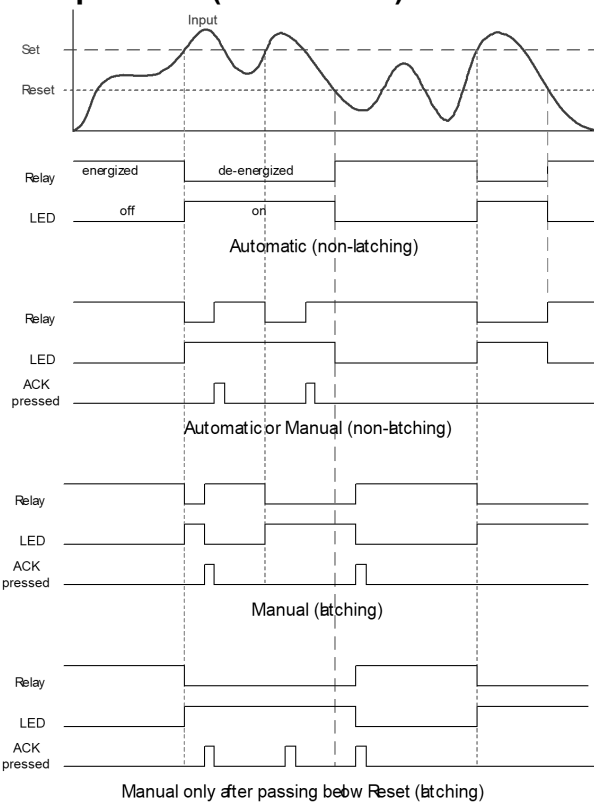


Low Alarm with Fail-Safe Operation (Set < Reset)

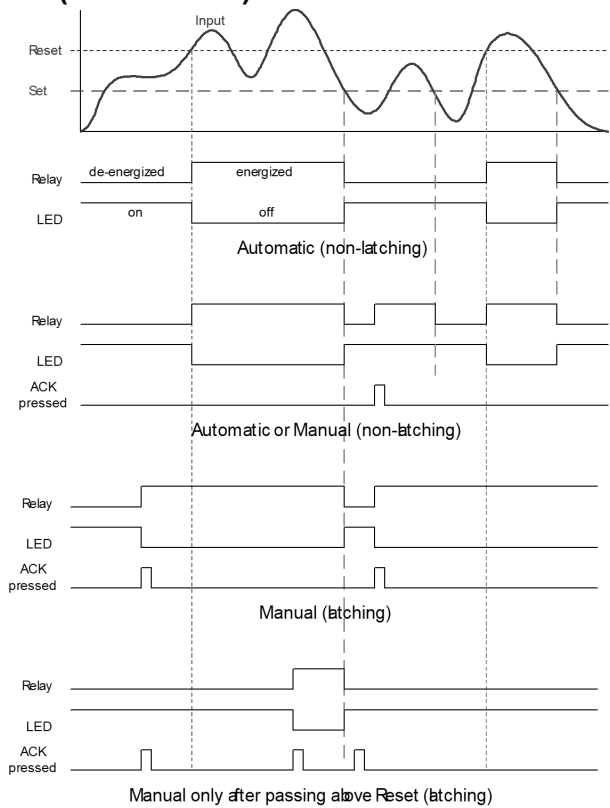


Note: Relay coil is energized in non-alarm condition. In case of power failure, relay will go to alarm state.

Pump Alternation Control Operation

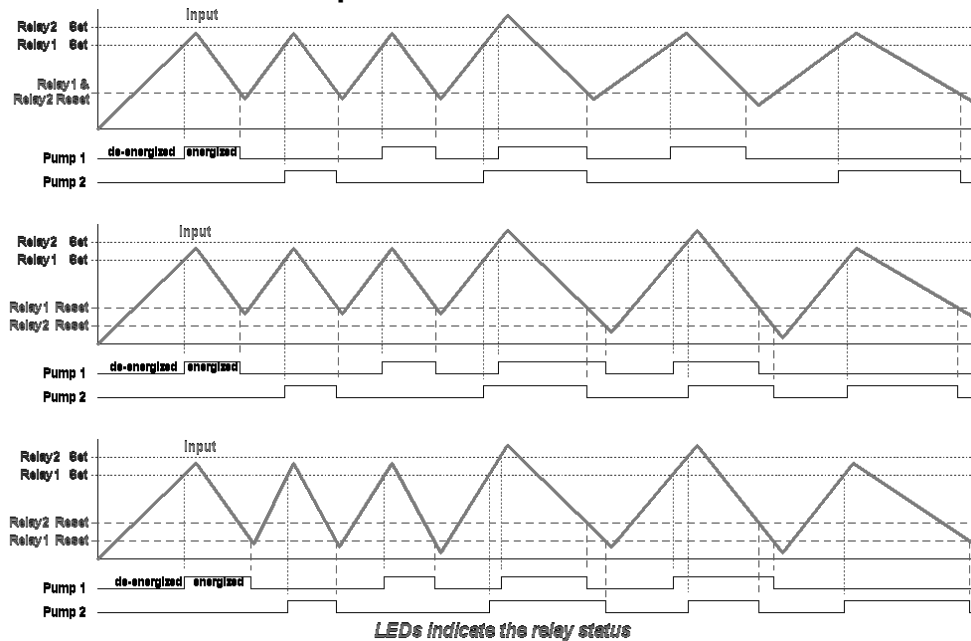

Relay Sampling Operation

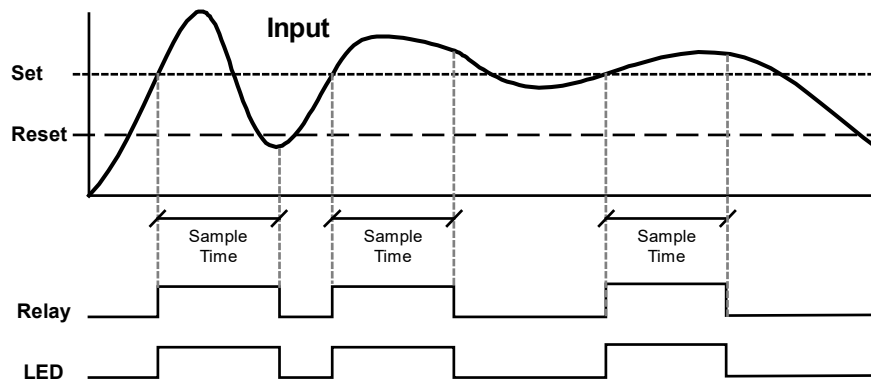


When the signal crosses the set point, the relay trips and the sample time starts. After the sample time has elapsed, the relay resets. The cycle repeats every time the set point is crossed, going up for high alarms and going down for low alarms.


The sample time can be programmed between 0.1 and 5999.9 seconds.

Time Delay Operation

The following graphs show the operation of the time delay function.

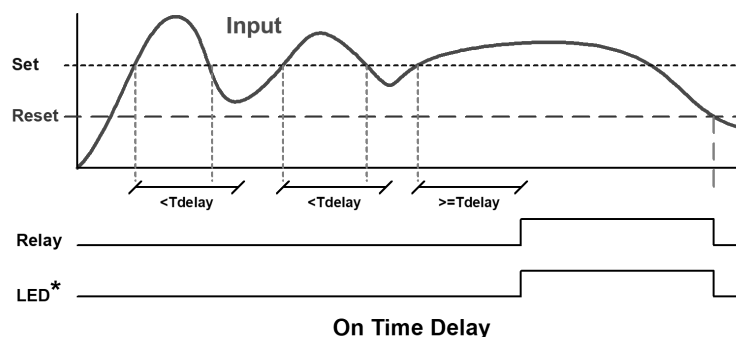

On Time Delay

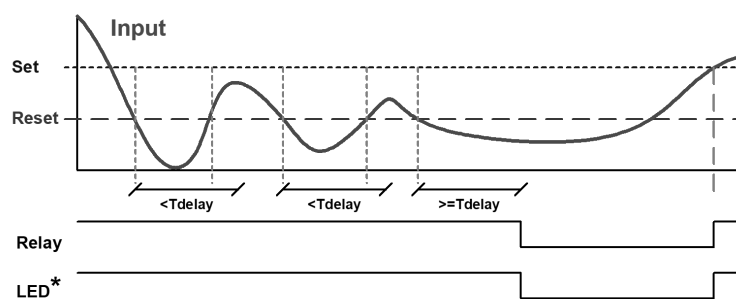

Off Time Delay

When the signal crosses the set point, the *On* time delay timer starts and the relay trips when the time delay has elapsed. If the signal drops below the set point (high alarm) before the time delay has elapsed, the *On* time delay timer resets and the relay does not change state. The same principle applies to the *Off* time delay.

Note: If "Automatic or Manual (R-n Rn)" reset mode is selected, the LED follows the reset point and not the relay state when the relay is acknowledged.

Relay Operation Details

Overview

The relay capabilities of the meter expand its usefulness beyond simple indication to provide users with alarm and control functions. These capabilities include front panel alarm status LEDs as well as either 2 or 4 optional internal relays and/or 4 external relays expansion module. Typical applications include high or low force, level, or pressure alarms, control applications such as simple on/off control, and relay alternation control for up to 8 pumps. There are four basic ways the relays can be used:

1. High or Low Alarms with Latching or Non-Latching Relays
2. Simple On/Off Control with 100% Adjustable Deadband
3. Sampling (Based on Time)
4. Alternation Control for up to 8 Pumps

Relays Auto Initialization

When power is applied to the meter, the front panel LEDs and alarm relays will reflect the state of the input to the meter. The following table indicates how the alarm LEDs and relays will react on power-up based on the set and reset points.

Alarm #	HI or LO Alarm	Set Point	Reset Point	Power-Up Reading	Relay & LED
1	HI	1000	500	499	Off
2	LO	700	900	499	On
3	LO	250	400	499	Off
4	HI	450	200	499	On

Fail-Safe Operation

The following table indicates how the relays behave based on the fail-safe selection for each relay:

Fail-Safe Selection	Non-Alarm State		Alarm State		Power Failure
	NO	NC	NO	NC	
Off	Open	Closed	Closed	Open	Relays go to non-alarm state
On	Closed	Open	Open	Closed	Relays go to alarm state

Note: NO = Normally Open, NC = Normally Closed. This refers to the condition of the relay contacts when the power to the meter is off.

Front Panel LEDs

The LEDs on the front panel provide status indication for the following:

The meter is supplied with four alarm points that include front panel LEDs to indicate alarm conditions. This standard feature is particularly useful for alarm applications that require visual-only indication. The LEDs are controlled by the set and reset points programmed by the user. When the display reaches a set point for a high or low alarm, the corresponding alarm LED will turn on. When the display returns to the reset point the LED will go off. The front panel LEDs respond differently for latching and non-latching relays.

For non-latching relays, the LED is always off during normal condition and always on during alarm condition, regardless of the state of the relay (e.g. Relay acknowledged after alarm condition).

For latching relays, the alarm LEDs reflect the status of the relays, regardless of the alarm condition. The following tables illustrate how the alarm LEDs function in relation to the relays and the acknowledge button (Default: F3 key assigned to ACK).

LED	Status	LED	Status
1	Alarm 1	5	Alarm 5
2	Alarm 2	6	Alarm 6
3	Alarm 3	7	Alarm 7
4	Alarm 4	8	Alarm 8

Latching and Non-Latching Relay Operation

The relays can be set up for latching (manual reset) or non-latching (automatic reset) operation.

The On and Off terminology does not refer to the status of the relay's coil, which depends on the fail-safe mode selected.

Relay terminology for following tables	
Terminology	Relay Condition
On	Alarm (Tripped)
Off	Normal (Reset)
Ack	Acknowledged



Warning!

In latching relay mode, latched relays will reset (unlatch) when power is cycled.

Non-Latching Relay (R_{ULO})

In this application, the meter is set up for automatic reset (non-latching relay). Acknowledging the alarm while it is still present has no effect on either the LED or the relay. When the alarm finally goes away, the relay automatically resets and the LED also goes off.

Automatic reset only		
Condition	LED	Relay
Normal	Off	Off
Alarm	On	On
Ack (No effect)	On	On
Normal	Off	Off

Non-Latching Relay (R_{NR} R_N)

In this application, the meter is set up for automatic and manual reset at any time (non-latching relay). The LED and the relay automatically reset when the meter returns to the normal condition.

The next time an alarm occurs, the operator acknowledges the alarm manually while the alarm condition still exists. This causes the relay to reset, but the LED stays on until the meter returns to the normal condition.

Automatic + manual reset at any time		
Condition	LED	Relay
Normal	Off	Off
Alarm	On	On
Normal	Off	Off
Next Alarm	On	On
Ack	On	Off
Normal	Off	Off

Latching Relay (LR_{LCH})

In this application, the meter is set up for manual reset at any time. Acknowledging the alarm even if the alarm condition is still present resets the relay and turns off the LED.

Manual reset any time		
Condition	LED	Relay
Normal	Off	Off
Alarm	On	On
Ack	Off	Off

Latching Relay (LR_{LCL})

In this application, the meter is set up for manual reset only after the signal passes the reset point (alarm condition has cleared). Acknowledging the alarm while it is still present has no effect on either the LED or the relay. When the alarm is acknowledged after it returns to the normal state, the LED and the relay go off. Notice that the LED remains on, even after the meter returns to the normal condition. This is because, for latching relays, the alarm LED reflects the status of the relay, regardless of the alarm condition.

Manual reset only after alarm condition has cleared		
Condition	LED	Relay
Normal	Off	Off
Alarm	On	On
Ack (No effect)	On	On
Normal	On	On
Ack	Off	Off

Acknowledging Relays

There are two ways to acknowledge relays programmed for manual reset:

1. Via the programmable front panel function keys F1-F3 (Assignable via the *User* menu inside the *Advanced Features* menu).
2. Remotely via a normally open pushbutton wired across one of the digital inputs and the +5 V terminals on the digital I/O modules, or using the F4 digital input (factory default setting), which is triggered with a contact closure to COM, or with an active low signal (see page 16).

When the ACK button or the assigned digital input is closed, all relays programmed for manual reset are acknowledged.

*Note: The function key and digital input assignment is changed in the **Advanced – User** menu.*

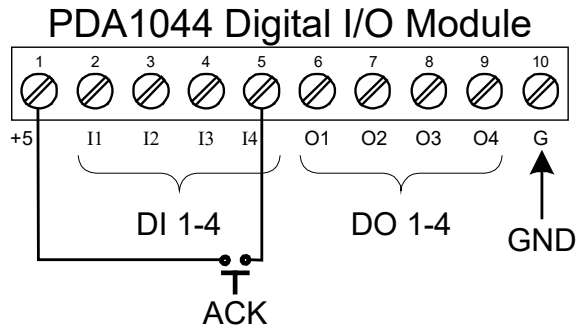


Figure 23. Acknowledge Relays with Digital Input

Pump Alternation Control Applications (*RLLErn*)

For pump control applications where two or more similar pumps are used to control the level of a tank, it is desirable to have all the pumps operate alternately. This prevents excessive wear and overheating of one pump over the lack of use of the other pumps.

Up to 8 relays can be set up to alternate every time an on/off pump cycle is completed. The set points and reset points can be programmed, so that the first pump on is the first pump off.

Application #1: Pump Alternation Using Relays 1 & 2

1. Relays 1 and 2 are set up for pump alternation.
2. Relays 3 and 4 are set up for low and high alarm indication.

Set and Reset Point Programming			
Relay	Set Point	Reset Point	Function
1	30.000	10.000	Controls pump #1
2	35.000	5.000	Controls pump #2
3	4.000	9.000	Controls low alarm
4	40.000	29.000	Controls high alarm

Pump Alternation Operation

1. Pump #1 turns on when level reaches 30.000, when level drops below 10.000 pump #1 turns off.
2. The next time level reaches 30.000, pump #2 turns on, when level drops below 10.000 pump #2 turns off.
3. If the level doesn't reach 35.000 pump #1 and pump #2 will be operating alternately.
4. If pump #1 cannot keep the level below 35.000 pump #2 will turn on at 35.000, then as the level drops to 10.000 pump #1 turns off, pump #2 is still running and shuts off below 5.000.
5. Notice that with the set and reset points of pump #2 outside the range of pump #1, the first pump on is the first pump to go off. This is true for up to 8 alternating pumps, if setup accordingly.
6. Relay #3 will go into alarm if the level drops below 4.000 and relay #4 will go into alarm if the level exceeds 40.000.
7. Adding the 4 external relays expansion module allows using the 4 SPDT internal relays for pump alternation and the 4 SPST external relays for high, high-high, low, and low-low alarm indication.


Application #2: Pump Alternation Using Relays 3 & 4

- Relays 1 and 2 are set up for low and high alarm indication.
- Relays 3 and 4 are set up for pump alternation.


Set and Reset Point Programming			
Relay	Set Point	Reset Point	Function
1	495	750	Controls low alarm
2	7500	6900	Controls high alarm
3	7000	900	Controls backup pump
4	6000	1000	Controls main pump

The following graphics provide a visual representation of a typical pump alternation application with high and low alarm monitoring.


- Relay #4 turns the main pump on at 6000 gallons and turns it off at 1000 gallons.

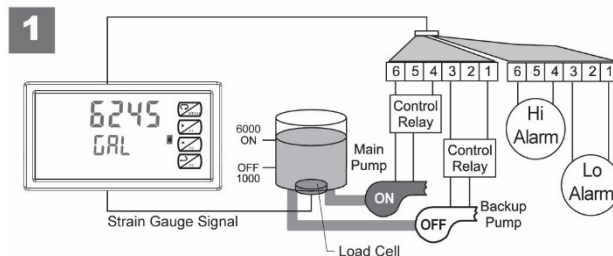


- With the Pump Alternation feature activated, the next time the level reaches 6000 gallons, relay #3 transfers and starts the backup pump.

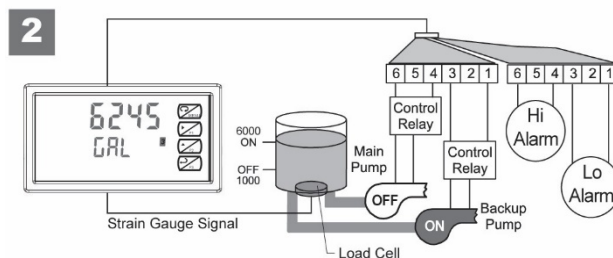


- If the backup pump is not able to keep up, and the level reaches 7000 gallons, relay #4 transfers and starts the main pump as well.

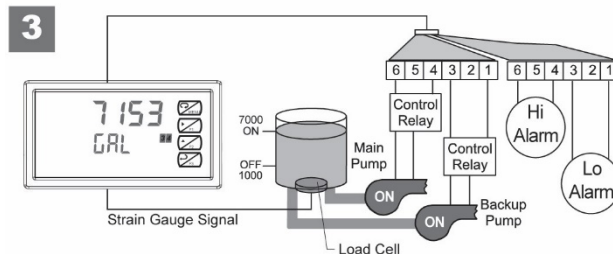

- Relay #2 trips the High Level Alarm at 7500 gallons and resets at 6900 gallons.

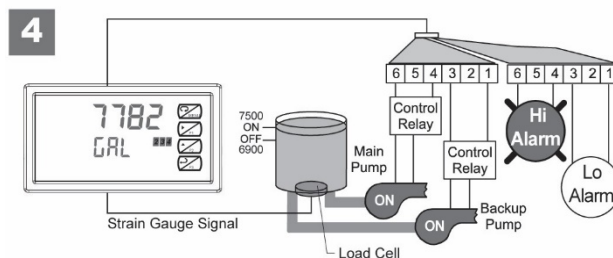


- Relay #1 trips the Low Level Alarm at 495 gallons and resets at 750 gallons.

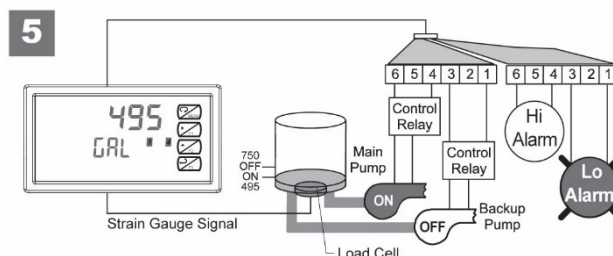


Setting Up the Interlock Relay (Force On) Feature

Relays 1-4 can be set up as interlock relays. To set up the relays for the interlock feature:


1. Access the *Setup – Relay – Action* menu and set the action to off.

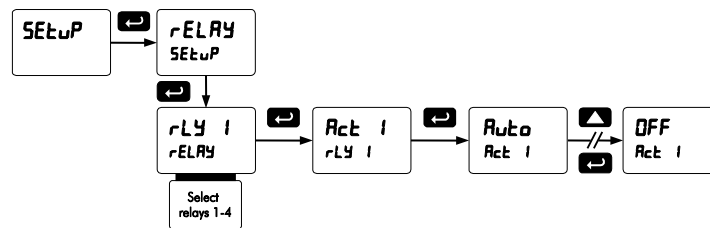

2. In the Advanced features – *User* menu program any of the digital inputs to *Force On* any of the internal relays (1-4).



3. Connect a switch or dry contact between the +5V terminal and the corresponding digital input (DI-1 to DI-4) terminal.

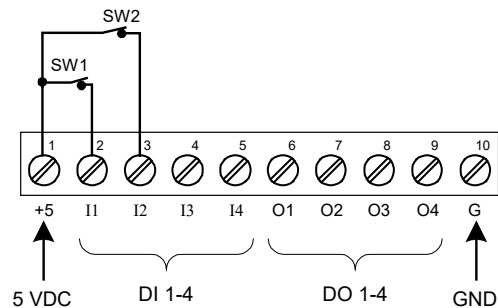

Interlock Relay Operation Example


Relays 1 & 2 are configured to energize (their front panel LEDs are off) when SW1 & SW2 switches (above) are closed. If the contacts to these digital inputs are opened, the corresponding front panel LEDs flash indicating this condition. The processes being controlled by the interlock relay will stop, and will restart only after the interlock relay is re-activated by the digital inputs (switches).

Scaling the 4-20 mA Analog Output (Rout)

The 4-20 mA analog output can be scaled to provide a 4-20 mA signal for any display range selected.

No equipment is needed to scale the analog output; simply program the display values to the corresponding mA output signal.

The *Analog Output* menu is used to program the 4-20 mA output based on display values.

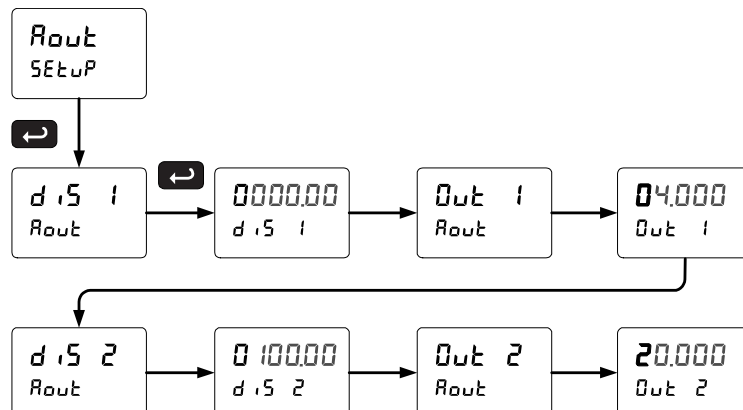

For instructions on how to program numeric values see Setting Numeric Values, page 22.

Setting Up the Password (PASS)


The *Password* menu is used for programming three levels of security to prevent unauthorized changes to the programmed parameter settings.

Pass 1: Allows use of function keys and digital inputs
 Pass 2: Allows use of function keys, digital inputs and editing set/reset points
 Pass 3: Restricts all programming, function keys, and digital inputs.

Protecting or Locking the Meter

Enter the *Password* menu and program a six-digit password.

For instructions on how to program numeric values see Setting Numeric Values, page 22.

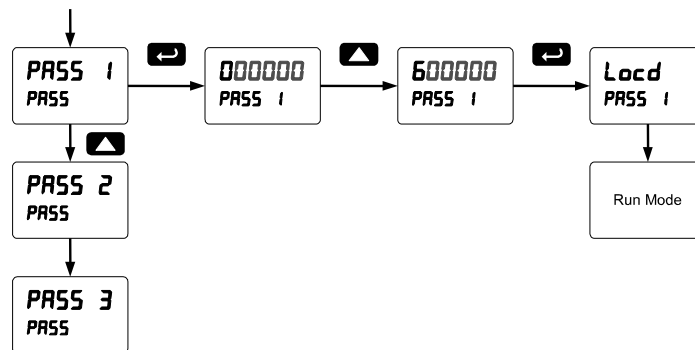


Making Changes to a Password Protected Meter

If the meter is password protected, the meter will display the message *Locd* (Locked) when the Menu button is pressed. Press the Enter button while the message is being displayed and enter the correct password to gain access to the menu. After exiting the programming mode, the meter returns to its password protected condition.

Disabling Password Protection

To disable the password protection, access the *Password* menu and enter the correct password twice, as shown below. The meter is now unprotected until a new password is entered.

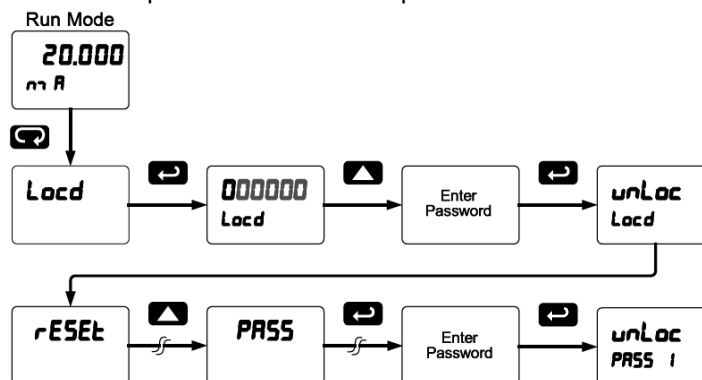

If the correct six-digit password is entered, the meter displays the message *unLoc* (unlocked) and the protection is disabled until a new password is programmed.

If the password entered is incorrect, the meter displays the message *Locd* (Locked) for about two seconds, and then it returns to Run Mode. To try again, press Enter while the *Locked* message is displayed.

Did you forget the password?

The password may be disabled by entering a master password once. If you are authorized to make changes, enter the master password 508655 to unlock the meter.

Reset Menu (rESEt)

The *Reset* menu is used to reset the tare (rSEt Er) and the maximum or minimum readings (peak or valley) reached by the process; max & min may be reset at the same time by selecting “reset high & low” (rSEt HL).

Note: Resetting the tare resets the max & min readings.

Tare Menu (tArE)

The *Tare* menu is used to select the tare mode. There are three modes of operation: *Capture Tare*, *Programmable Tare*, and *Off*.


Capture Tare: Pressing the Tare key zeroes the display and the “T” indicator flashes indicating that tare is applied to the reading (e.g. Net weight).

Programmable Tare: Program a known value to be subtracted from the display value to obtain the net value. Pressing Reset tare clears the tare value to zero. Programmable Tare will not tare negative PVs. Use Capture Tare for negative PVs.

Off: Tare function is disabled and pressing Tare key has no effect.


Tare Functionality (tArE)

The tare function zeroes out the display. In the case of scale weight, tare is used to eliminate container weight and provide net weight readings.

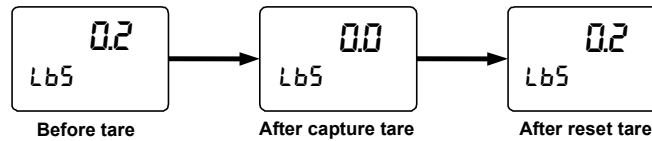

Control Menu (Contrl)


The *Control* menu is used to control the 4-20 mA analog output and the relays manually, ignoring the input. Each relay and analog output can be programmed independently for manual control. Selecting automatic control sets all relays and analog output for automatic operation.

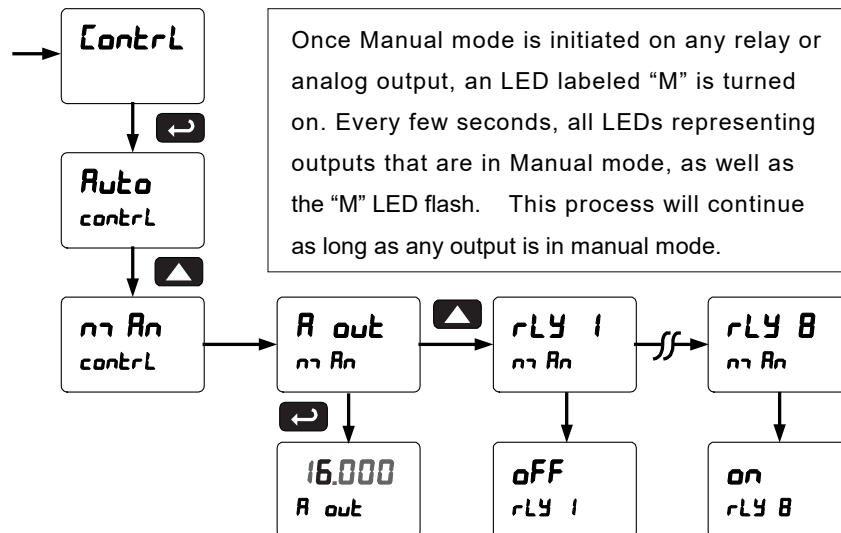

Advanced Features Menu

To simplify the setup process, functions not needed for most applications are located in the *Advanced Features* menu.

Press and hold the Menu button for three seconds to access the advanced features of the meter.

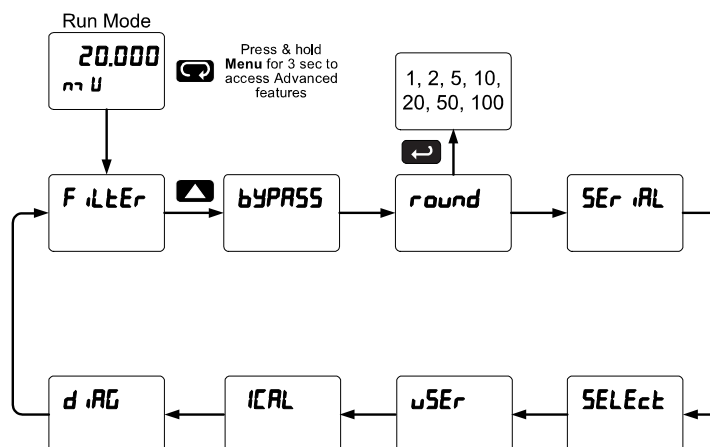

Advanced Features Menu & Display Messages

The following table shows the functions and messages of the *Advanced Features* menu in the order they appear in the menu.

Display	Parameter	Action/Setting
fil t Er	<i>Filter</i>	Set noise filter value
bypASs	<i>Bypass</i>	Set filter bypass value
Round	<i>Rounding</i>	Select rounding value
seriAl	<i>Serial</i>	Set serial communication parameters
Slaveld	<i>Slave ID</i>	Set slave ID or meter address
baud	<i>Baud rate</i>	Select baud rate
Tr dLY	<i>Transmit delay</i>	Set transmit delay for serial communication
Parity	<i>Parity</i>	Select parity Even, Odd, or None with 1 or 2 stop bits
t - byt	<i>Time byte</i>	Set byte-to-byte timeout
SElEct	<i>Select</i>	Enter the Select menu (function, cutoff, out)
Functn	<i>Signal input conditioning</i>	Linear, select number of points
Linear	<i>Linear</i>	Set meter for linear function and select number of linearization points
Pv 1	<i>PV1</i>	Select PV1 number of linearization points
Pv 2	<i>PV2</i>	Select PV2 number of linearization points
No PtS	<i>Number of points</i>	Set PV1 for 2 to 32-point linearization Set PV2 for 2 to 8-point linearization

Display	Parameter	Action/Setting
SCALE	<i>Scale</i>	Scaling parameter
SCAL 1	<i>Scale 1</i>	Scaling parameter 1
SCAL 2	<i>Scale 2</i>	Scaling parameter 2
CutoffF	<i>Cutoff</i>	Set low-flow cutoff
Auto 0	<i>Auto Zero</i>	Enter the Auto Zero function (on/off)
AoutPr	<i>Analog output programming</i>	Program analog output parameters
Source	<i>Source</i>	Select source for the 4-20 mA output
O- rang	<i>Overrange</i>	Program mA output for display overrange
u- rang	<i>Underrange</i>	Program mA output for display underrange
nmAx	<i>Maximum</i>	Program maximum mA output allowed
nmin	<i>Minimum</i>	Program minimum mA output allowed
Calib	<i>Calibrate</i>	Calibrate 4-20 mA output (internal reference source used for scaling the output)
4 n mA	<i>4 mA output</i>	Enter mA output value read by milliamp meter with at least 0.001 mA resolution
20 n mA	<i>20 mA output</i>	Enter mA output value read by milliamp meter with at least 0.001 mA resolution

Display	Parameter	Action/Setting
user	User I/O	Assign function keys and digital I/O
F1*	F1 function key	Assign F1 function key (*F1/F2/F3)
F4	F4 function	Assign F4 function (digital input)
dI 1	Digital input 1	Assign digital input 1 – 8, if expansion modules are connected
dO 1	Digital output 1	Assign digital output 1 – 8, if expansion modules are connected
I Cal	Internal source calibration	Enter internal source calibration (used for scaling the meter without a signal source)
15nmV	15 mV calibration	Calibrate 15 mV input range (internal reference source used for scaling the input)
20nmV	20 mV calibration	Calibrate 30 mV input range (internal reference source used for scaling the input)

Display	Parameter	Action/Setting
100nmV	100 mV calibration	Calibrate 150 mV input range (internal reference source used for scaling the input)
200nmV	200 mV calibration	Calibrate 300 mV input range (internal reference source used for scaling the input)
str off	Strain offset	Calibrate the offset of the input circuit
v Lo	mV low	Calibrate low mV input (e.g. 0 mV)
v Hi	mV high	Calibrate high mV input (e.g. 100 mV)
Di ag	Diagnostics	Display test and information
LED t	LED test	Test all LEDs
I n f o	Information	Display software and S/N information
Er a s e	Erase	Erase MeterView Pro software stored in meter's memory

Noise Filter (F ILTFR)

The noise filter is available for unusually noisy signals that cause an unstable process variable display. The noise filter averages the input signal over a certain period. The filter level determines the length of time over which the signal is averaged. The filter level can be set between 2 and 199. The higher the filter level, the longer the averaging time and so the longer it takes the display to settle to its final value. Setting the filter level to zero disables the filter function.

Noise Filter Bypass (bYPASS)

The noise filter bypass changes the behavior of the meter so that small variations in the signal are filtered out but large abrupt changes in the input signal are displayed immediately. The bypass value determines the minimum amount of signal change to be displayed immediately. All signal changes smaller than the bypass value are filtered or averaged by the meter. The noise filter bypass may be set between 0.1 and 99.9% of full scale.

Rounding Feature (round)

The rounding feature is used to give the user a steadier display with fluctuating signals. Rounding is used in addition to the filter function.

Rounding causes the display to round to the nearest value according to the rounding selected. This setting affects the last two digits, regardless of decimal point position. See examples below:

Rounding Selection	Actual Value	Display Value	Actual Value	Display Value
1	12.022	12.022	12.023	12.023
5	12.022	12.020	12.023	12.025
10	12.024	12.020	12.025	12.030


Modbus RTU Serial Communications (SErIAL)

The meter is equipped with serial communications capability as a standard feature using Modbus RTU Serial Communication Protocol.

The meter may be connected to a PC for initial configuration via the onboard micro USB connection. For ongoing digital communications with a computer or other data terminal equipment, an RS-232, or RS-485 option is required; see *Ordering Information* on page 5 for details.

Warning! *Do not connect any equipment other than Interface Inc. expansion modules, cables, or meters to the RJ45 M-LINK connector. Otherwise damage will occur to the equipment and the meter.*

Note: More detailed instructions are provided with each optional serial communications adapter.

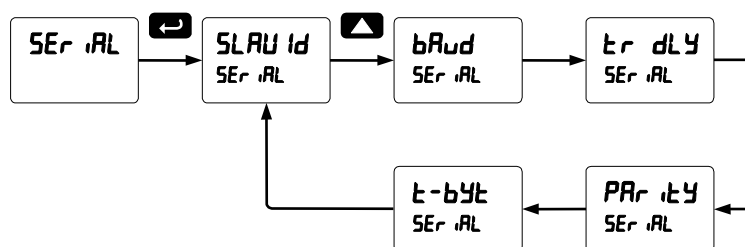


When using more than one meter in a multi-drop mode, each meter must be provided with its own unique address. The meter address (Slave ID) may be programmed between 1 and 247. The transmit delay may be set between 0 and 199 ms. The parity can be set to even, odd, or none with 1 or 2 stop bits.

Select Menu (SELEct)

The *Select* menu is used to select the signal input conditioner applied to the input (linear), low cutoff, Auto-zero, and analog output programming.

The multi-point linearization is part of the linear function selection.

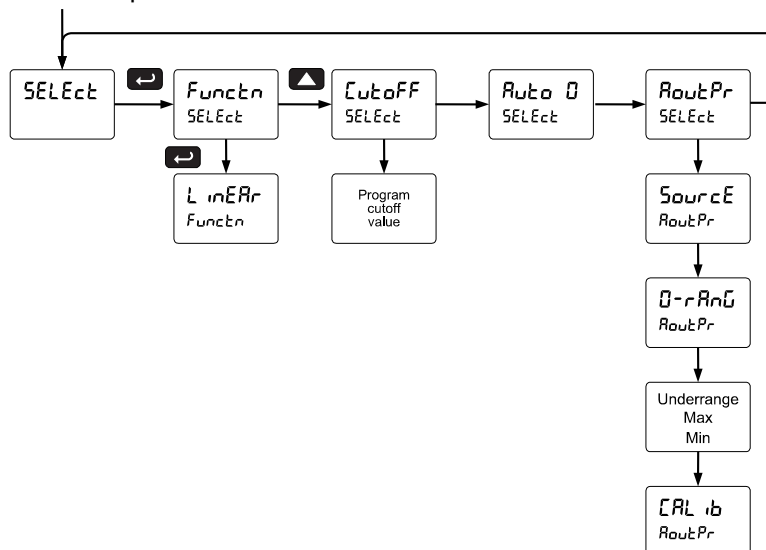

Signal Input Conditioning (Function)


The *Function* menu is used to select the signal input conditioner applied to the input: linear. The multi-point linearization is part of the linear function selection.

Meters are set up at the factory for linear function signal with 2-point linearization. The linear function provides a display that is linear with respect to the input signal.

Multi-Point Linearization (L inERR)

Meters are set up at the factory for linear function with 2-point linearization. Up to 32 linearization points can be selected for PV under the linear function. The multi-point linearization can be used to linearize the display for non-linear signals such as those from level Sensors used to measure volume in odd-shaped tanks or to convert level to flow using weirs and flumes with complex exponent.

If the dual-scale Level feature has been selected, the menus for PV1 & PV2 are enabled. PV2 can be programmed with up to 8 linearization points.

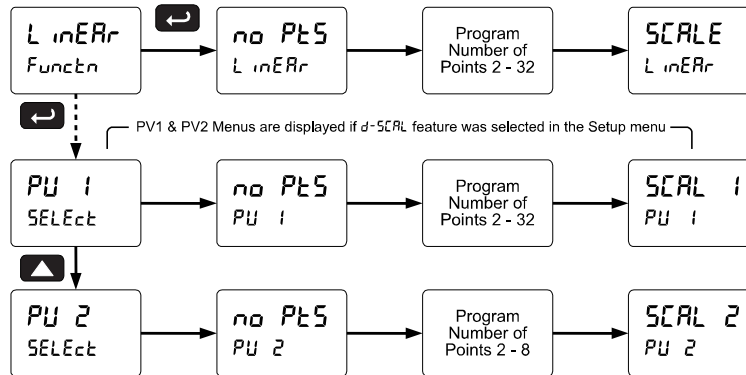

Auto-Zero (Auto 0)

Auto-zero corrects for drift that can occur over time that causes the input signal to slowly change. The meter will continue to read zero despite slow and small changes to the input signal. The auto-zero value represents the percent of full scale drift that the meter will correct.

Under normal circumstances, when the signal increases quickly, by an amount greater than the auto-zero percent of full scale, the value will not be adjusted for. Slow signal changes that occur over time at increments less than the auto-zero value, will not register on the meter (example: dust on a load cell or sensor drift over time).

Low Cutoff (CutoffFF)

The low cutoff feature allows the meter to be programmed so that the often-unsteady output from a differential pressure Sensor, at low flow rates, always displays zero on the meter.

The cutoff value may be programmed from 0 to 999999. The meter will display zero below the cutoff value. Programming the cutoff value to zero disables the cutoff feature.


Analog Output Programming (RoutePr)

The *Analog Output Programming* menu is used to program the behavior of the 4-20 mA output. The following parameters and functions are programmed in this menu:

1. Source: Source for generating the 4-20 mA output (e.g. PV)
2. Overrange: Analog output value with display in overrange condition
3. Underrange: Analog output value with display in underrange condition
4. Max: Maximum analog output value allowed regardless of input
5. Min: Minimum analog output value allowed regardless of input
6. Calibrate: Calibrate the internal 4-20 mA source reference used to scale the 4-20 mA output

Analog Output Source

The source for generating the 4-20 mA output may be assigned to the process variable, maximum or minimum value reached by the process, one of the set points, or the Modbus PV input.

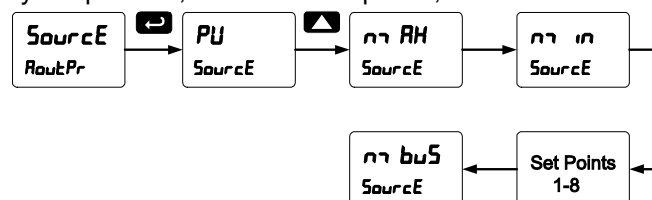


Analog Output Calibration

To perform the analog output calibration, it is recommended to use a milliamp meter with a resolution of at least 0.1 μA to measure the output current. The values saved internally during this procedure are used for scaling the 4-20 mA output in the *Setup* menu.

Programmable Function Keys User Menu (μSEr)

The *User* menu allows the user to assign the front panel function keys F1, F2, and F3, the digital input F4 (a digital input located on the signal input connector), and up to eight additional digital inputs to access most of the menus or to activate certain functions immediately (e.g. reset max & min, hold relay states, etc.). This allows the meter to be greatly customized for use in specialized applications.

Up to eight digital outputs can be assigned to a number of actions and functions executed by the meter (i.e. alarms, relay acknowledgement, reset max, min, or max & min, tare, and reset tare). The digital outputs can be used to trigger external alarms or lights to indicate these specific events.

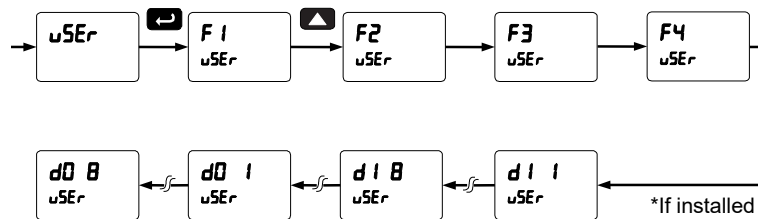

Function Keys & Digital I/O Available Settings

Refer to the following table for descriptions of each available function key or digital I/O setting.

Display	Description
Rst Hi	Reset the stored maximum display value
Rst Lo	Reset the stored minimum display value
Rst HL	Reset the stored maximum & minimum display values
tare	Capture tare and zero the display
Rst tr	Reset captured tare and resume normal operation
relay	Directly access the relay menu
Set 1*	Directly access the set point menu for relay 1 (*through 8)
Rl y d	Disable all relays until a button assigned to <i>enable relays (Rly E)</i> is pressed
Rly E	Enable all relays to function as they have been programmed
O Hold	Hold current relay states as they are until a button assigned to <i>enable relays (Rly E)</i> is pressed
d Hold	Hold the current display value momentarily while the function key or digital input is active. The process value will continue to be calculated in the background.
Ln1 Hi	Display maximum display value on line 1

Display	Description
Ln1 Lo	Display minimum display value on line 1
Ln1 HL	Display maximum & minimum display values on line 1
Ln2mV	Display the mV input on line 2
Ln2 Hi	Display maximum display value on line 2
Ln2 Lo	Display minimum display value on line 2
Ln2 HL	Display maximum & minimum display values on line 2
zero	Zero the display (this is different from <i>capture tare</i> because it cannot be reset)
F On 1 *	Force relay 1 (*through 4) into the on state. This function is used in conjunction with a digital input expansion module to achieve interlock functionality. See page 39 for details about interlock relays.
Contrl	Directly access the control menu
disabl	Disable the selected function key or digital I/O
AcH	Acknowledge all active relays that are in a manual operation mode such as auto-manual or latching
Reset	Directly access the reset menu

Display	Description
nmenu	Mimic the menu button functionality (digital inputs only)
rigHt	Mimic the right arrow/F1 button functionality (digital inputs only)
up	Mimic the up arrow/F2 button functionality (digital inputs only)

Display	Description
Enter	Mimic the enter/F3 button functionality (digital inputs only)
Al nm 1*	Provide indication when alarm 1 (*through 8) has been triggered (digital outputs only)

Internal Source Calibration (ICRL)

The meter is factory calibrated prior to shipment to read in millivolts. The calibration equipment is certified to NIST standards. There is no need to perform an internal calibration for new meter.

The internal source allows the user to scale the meter without applying a signal.

The use of calibrated signal sources is necessary to perform the internal source calibration of the meter.

Check calibration of the meter at least every 12 months. Each range must be recalibrated separately.

Notes:


1. *mV input: If meter is in operation and it is intended to accept only one input range (e.g. 0-30 mV), recalibration of other ranges is not necessary.*
2. *Strain gauge: If the meter is intended to accept a strain gauge bridge input, it is recommended to use the CAL function with ratiometric compensation turned on.*
3. *Allow the meter to warm up for at least 15 minutes before performing the internal source calibration procedure.*

The *Internal calibration* menu is part of the *Advanced Features* menu.

1. Press and hold the Menu button for three seconds to access the advanced features of the meter.
2. Press the Up arrow button to scroll to the *Internal calibration* menu (ICRL) and press Enter.
3. The meter displays the first input range (15 mV), press the Up arrow to select any other range (e.g. 100 mV). Press Enter to start the calibration process.

Example of Internal Calibration for 100 mV input range:

4. The meter displays the message "StrOFF" (strain offset), short the SG+, SG- terminals and press Enter. The *low* input message is displayed (U Lo). Apply the low input signal (e.g. 0.00 mV) and press Enter. The display flashes for a moment while the meter is accepting the low input signal.
5. After the display stops flashing, a number is displayed with the leftmost digit brighter than the rest. The bright digit is the active digit that can be changed by pressing the Up arrow button. Press the Right arrow button to move to the next digit.
6. Set the display value to correspond to the input signal being calibrated; typically 0.00 mV.
7. The display moves to the *high* input calibration (U Hi). Apply the high input signal and press Enter.
8. Set the display for the high input calibration, in the same way as it was set for the low input calibration, typically 100.00 mV.

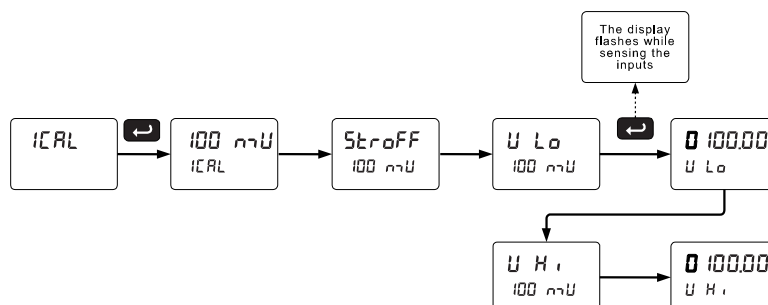

The graphic above shows the calibration of the 100 mV input range. The other input ranges are calibrated in a similar way.

Tips:

- Low and high input signals can be any valid values within the range of the meter.
- Observe minimum input span requirements between input 1 and input 2.
- Low input should be less than high input signal.

Error Message (Error)

An error message indicates that the calibration or scaling process was not successful.

After the error message is displayed, the meter reverts to input 2 during calibration or scaling and to input 1 during internal calibration, allowing the appropriate input signal to be applied or programmed.

The error message might be caused by any of the following conditions:

1. Input signal is not connected to the proper terminals, or it is connected backwards.
2. Wrong signal selection in *Setup* menu.
3. Minimum input span requirements not maintained.

Minimum Input Span

The minimum input span is the minimum difference between input 1 and input 2 signals required to complete the calibration or scaling of the meter.

Input Range	Input 1 & Input 2 Span
15 mV	0.2 mV
25 mV, 30 mV	0.4 mV
150 mV	2.0 mV
250 mV, 300 mV	4.0 mV

Meter Operation

The meter is capable of accepting any signal from -250 to 250 mV in bipolar mode, or 0 to 300 mV in unipolar mode, and displaying these signals in engineering units from -99999 to 999999 (e.g. a 0-100 mV signal could be displayed as 0 to 50000). The dual-line display can be customized by the user to operate in such a way as to satisfy a specific application. Typically, display line 1 is used for the process variable; while line 2 is used for engineering units, custom legend, or set point indication.

The input signal can be scaled to display the process in two different scales; for example, line 1 could indicate weight in pounds and line 2 could indicate percent of maximum weight capacity. The meter can also be set up to display the analog input on line 1 and the Modbus input on line 2. The relays and analog output can be programmed to operate from the Modbus PV input if the Modbus input has been assigned to display line 1.

During operation, the meter can be either tared or zeroed. The tare feature is useful for momentarily zeroing out of the display, in the case where there is additional weight than what is intended to be measured (e.g. a bucket on the scale is being filled with material). The meter will display a T to indicate that the display has been tared and taring is resettable via the reset tare operation. The zero feature is useful for permanent zeroing of the meter, in the case where there has been drift in the strain gauge output over time. The zero feature will zero out the display without indication or the ability to reset.

Front Panel Buttons Operation

Button	Description
	Press to enter or exit <i>Programming Mode</i> .
	Press to zero the meter or other parameter/ function assigned through the <i>User</i> menu.
	Press to reset tare or other parameter/function assigned through the <i>User</i> menu.
	Press to tare the display value or other parameters/function assigned through the <i>User</i> menu.

Function Keys Operation

During operation, the programmable function keys operate according to the way they have been programmed in the *Advanced Features – User* menu.

The table above shows the factory default settings for F1, F2, and F3.

Maximum/Minimum Readings

The max & min readings (peak & valley) reached by the process can be displayed either continuously or momentarily:


1. Display briefly by assigning to the F1-F3 function keys or to the digital inputs in the *User* menu. Any of the F1-F3 function keys (buttons) and the digital inputs can be programmed to reset the max & min readings.
2. Display continuously by assigning either display to max/min through the *Display* menu.

To display max reading using function key:

1. Press user assigned function key/digital input to display maximum reading since the last reset/power-up.
2. To reset max/min, press the Menu button, then the Up arrow/F2 button until the Reset (*rESEt*) menu is displayed.
3. Press the Up arrow/F2 button to select reset high (*rSt H i*), reset low (*rSt Lo*), or reset high and low (*rSt HL*) is displayed and then press the Enter/F3 button. The max and/or min displays are reset to actual values.
4. Press Menu to exit max/min display reading.

To display max/min readings continuously:

Assign either display to Max (*d H i*), Min (*d Lo*), or toggle between Max and Min (*d HL*) every 10 seconds.

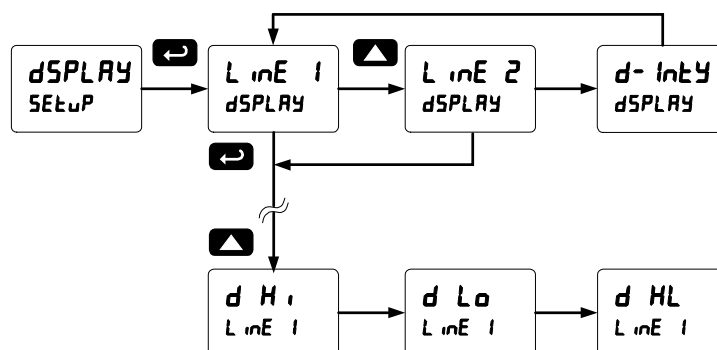

Troubleshooting

Due to the many features and functions of the meter, it's possible that the setup of the meter does not agree with what an operator expects to see. If the meter is not working as expected, refer to the *Diagnostics* menu and consult the recommendations described below.

Diagnostics Menu (d ,RG)

The *Diagnostics* menu is located in the *Advanced Features* menu, to access *Diagnostics* menu see *Advanced Features Menu*, page 42.

This menu allows the user to test the functionality of all the meter LEDs, check the meter's software and version information, and erase the MeterView Pro software installation files from the meter. Press the Enter button to view the settings and the Menu button to exit at any time.

For a description of the diagnostic messages, see *Advanced Features Menu & Display Messages*, page 42.

Determining Software Version

To determine the software version of a meter:


1. Go to the *Diagnostics* menu (d ,RG) and press Enter button.
2. Press Up arrow button and scroll to Information menu (InF0).
3. Press Enter to access the software number (SFlt) and version (UEr) information. Write down the information as it is displayed. Continue pressing Enter until all the information is displayed.
4. The meter returns to Run Mode after displaying all the settings.

Reset Meter to Factory Defaults

When the parameters have been changed in a way that is difficult to determine what's happening, it might be better to start the setup process from the factory defaults.

Instructions to load factory defaults:

1. Enter the *Advanced Features* menu. See *Advanced Features Menu*, page 42.
2. Press Up arrow to go to *Diagnostics* menu
3. Press and hold Right arrow for three seconds, press Enter when display flashes rESEt.
Note: If Enter is not pressed within three seconds, the display returns to the *Diagnostics* menu.
4. The meter goes through an initialization sequence (similar as on power-up), and loads the factory default settings.

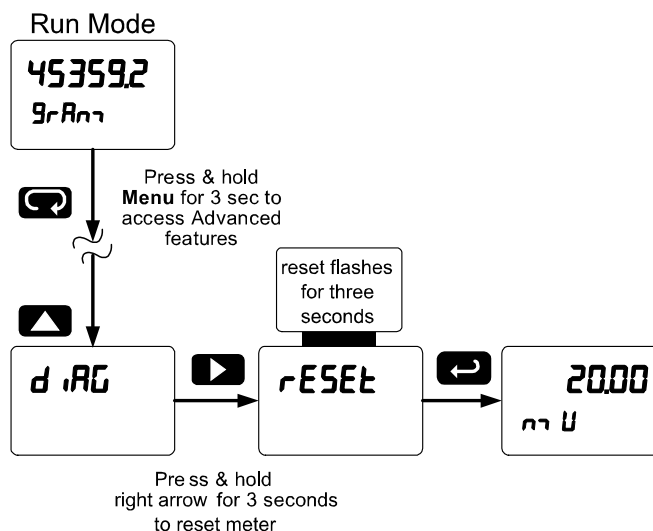

Factory Defaults & User Settings

The following table shows the factory setting for most of the programmable parameters on the meter.

Parameter	Display	Default Setting
Input type	<i>PoLAR</i>	Polar = Uni
Input Range	<i>rANGE</i>	Range = 30mV
Ratiometric	<i>rAtio</i>	Ratio = Yes
Dual-scale	<i>d-SCALE</i>	No (Single scale)
Filter	<i>FILTEr</i>	70
Bypass	<i>bYPASS</i>	0.2
Rounding	<i>round</i>	1
Function	<i>Function</i>	Linear
Number of points	<i>no Pts</i>	2
Programming	<i>Prog</i>	Scale
Input 1	<i>inP 1</i>	0.00 mV
Display 1	<i>d 1S 1</i>	0.00
Input 2	<i>inP 2</i>	100.00 mV
Display 2	<i>d 1S 2</i>	100.00
Decimal point	<i>ddddddd</i>	3 places
Cutoff value	<i>CutoffF</i>	0.000 (disabled)
Auto-zero	<i>Auto 0</i>	0.05% of Full Scale
Display assignment	<i>dSPLAY</i>	
Line 1	<i>L inE 1</i>	PV: Process variable
Line 2	<i>L inE 2</i>	Eng units: mV
Display intensity	<i>d- intY</i>	8
Relay 1 action	<i>Act 1</i>	Automatic
Relay 1 set point	<i>SEt 1</i>	10.00
Relay 1 reset point	<i>rSEt 1</i>	5.00
Relay 2 action	<i>Act 2</i>	Automatic
Relay 2 set point	<i>SEt 2</i>	20.00
Relay 2 reset point	<i>rSEt 2</i>	15.00
Relay 3 action	<i>Act 3</i>	Automatic
Relay 3 set point	<i>SEt 3</i>	30.00
Relay 3 reset point	<i>rSEt 3</i>	25.00
Relay 4 action	<i>Act 4</i>	Automatic
Relay 4 set point	<i>SEt 4</i>	40.00
Relay 4 reset point	<i>rSEt 4</i>	35.00

Parameter	Display	Default Setting
Fail-safe relay 1	<i>FLS 1</i>	Off
Fail-safe relay 2	<i>FLS 2</i>	Off
Fail-safe relay 3	<i>FLS 3</i>	Off
Fail-safe relay 4	<i>FLS 4</i>	Off
On delay relay 1	<i>On 1</i>	0.0 sec
Off delay relay 1	<i>OFF 1</i>	0.0 sec
On delay relay 2	<i>On 2</i>	0.0 sec
Off delay relay 2	<i>OFF 2</i>	0.0 sec
On delay relay 3	<i>On 3</i>	0.0 sec
Off delay relay 3	<i>OFF 3</i>	0.0 sec
On delay relay 4	<i>On 4</i>	0.0 sec
Off delay relay 4	<i>OFF 4</i>	0.0 sec
Display 1 analog out	<i>d 1S 1</i>	0.00
Output 1 value	<i>Out 1</i>	4.000 mA
Display 2 analog out	<i>d 1S 2</i>	100.00
Output 2 value	<i>Out 2</i>	20.000 mA
Source analog output	<i>Source</i>	Process Variable
Overrange output	<i>0-rANG</i>	21.000 mA
Underrange output	<i>u-rANG</i>	3.000 mA
Maximum output	<i>max RH</i>	23.000 mA
Minimum output	<i>min</i>	1.000 mA
Slave ID (Address)	<i>SLAVE id</i>	247
Baud rate	<i>baud</i>	9600
Transmit delay	<i>tr dLY</i>	10 ms
Parity	<i>PAR itY</i>	Even
Byte-to-byte timeout	<i>b-byt</i>	010 (0.1 sec)
F1 function key	<i>F 1</i>	Zero
F2 function key	<i>F 2</i>	Reset Tare
F3 function key	<i>F 3</i>	Tare
F4 Function	<i>F 4</i>	Acknowledge relays
Digital input 1	<i>d i 1</i>	Menu
Digital input 2	<i>d i 2</i>	Right arrow/F1
Digital input 3	<i>d i 3</i>	Up arrow/F2

Parameter	Display	Default Setting
Digital input 4	<i>d I 4</i>	Enter/F3
Digital output 1	<i>dO 1</i>	Alarm 1
Digital output 2	<i>dO 2</i>	Alarm 2
Digital output 3	<i>dO 3</i>	Alarm 3

Parameter	Display	Default Setting
Digital output 4	<i>dO 4</i>	Alarm 4
Password 1	<i>PRSS 1</i>	000000 (unlocked)
Password 2	<i>PRSS 2</i>	000000 (unlocked)
Password 3	<i>PRSS 3</i>	000000 (unlocked)

Troubleshooting Tips (Including FAULT & ERROR Messages)

Symptom	Check/Action
No display at all	Check power at power connector
Not able to change setup or programming, <i>Locd</i> is displayed	Meter is password-protected, enter correct six-digit password to unlock
Meter displays error message during calibration (<i>Error</i>)	Check: 1. Signal connections 2. Input selected in <i>Setup</i> menu 3. Minimum input span requirements
Meter displays 1. <i>999999</i> 2. <i>-999999</i> 3. <i>FAULT</i>	Check: 1. Input selected in <i>Setup</i> menu 2. Signal at Signal connector 3. Input exceeds range selected
Display is unstable	Check: 1. Input signal stability and value 2. Display scaling vs. input signal 3. Filter and bypass values (increase) 4. Increase Rounding value
Display response is too slow	Check filter and bypass values
Display reading is not accurate	Check: 1. Signal input conditioner selected: Linear, square root, etc. 2. Scaling or calibration
Display does not respond to input changes, reading a fixed number	Check: 1. Display assignment, it might be displaying max, min, or set point.
Display alternates between 1. <i>H I</i> and a number 2. <i>Lo</i> and a number	Press Menu to exit max/min display readings.
Relay operation is reversed	Check: 1. Fail-safe in <i>Setup</i> menu 2. Wiring of relay contacts
Relay and status LED do not respond to signal	Check: 1. Relay action in <i>Setup</i> menu 2. Set and reset points
Flashing relay status LEDs	Relays in manual control mode or relay interlock switches opened.
Meter not communicating with application programs	Check: 1. Serial adapter and cable 2. Serial settings 3. Meter address and baud rate
If the display locks up or the meter does not respond at all	Cycle the power to reboot the microprocessor.
Other symptoms not described above	Call Technical Support for assistance.

How to Contact Interface Inc.

- For Sales, Service or Support Call:
(800) 947-5598 or (480) 948-5555
- General & Technical Inquires Email:
contact@interfaceforce.com
- For the latest version of this manual please visit:
www.interfaceforce.com

INTERFACE, INC.

7418 East Helm Drive | Scottsdale, AZ 85260 | (800) 947-5598

interface
FORCE MEASUREMENT SOLUTIONS.
www.interfaceforce.com